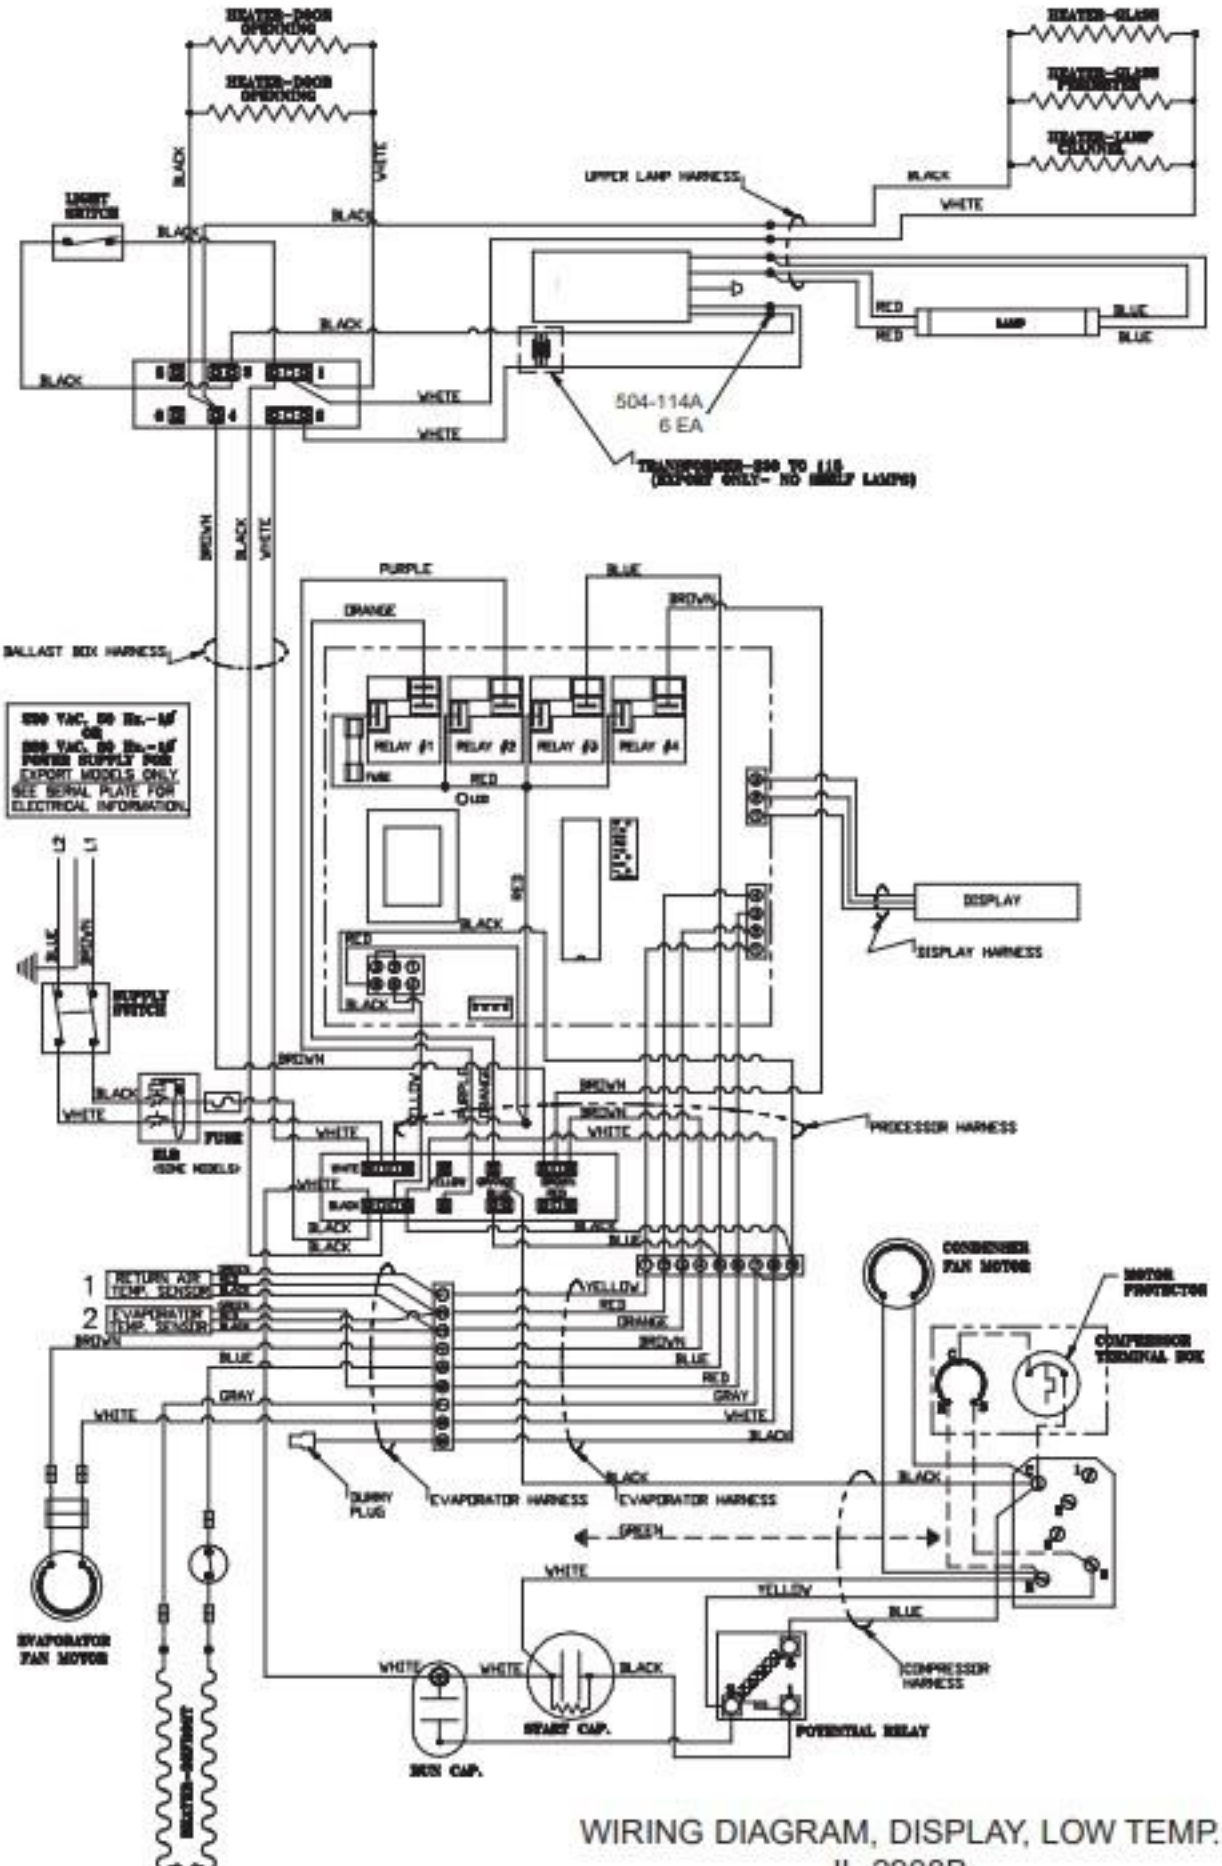

WIRING DIAGRAM, DISPLAY, LOW TEMP.
IL-2908B

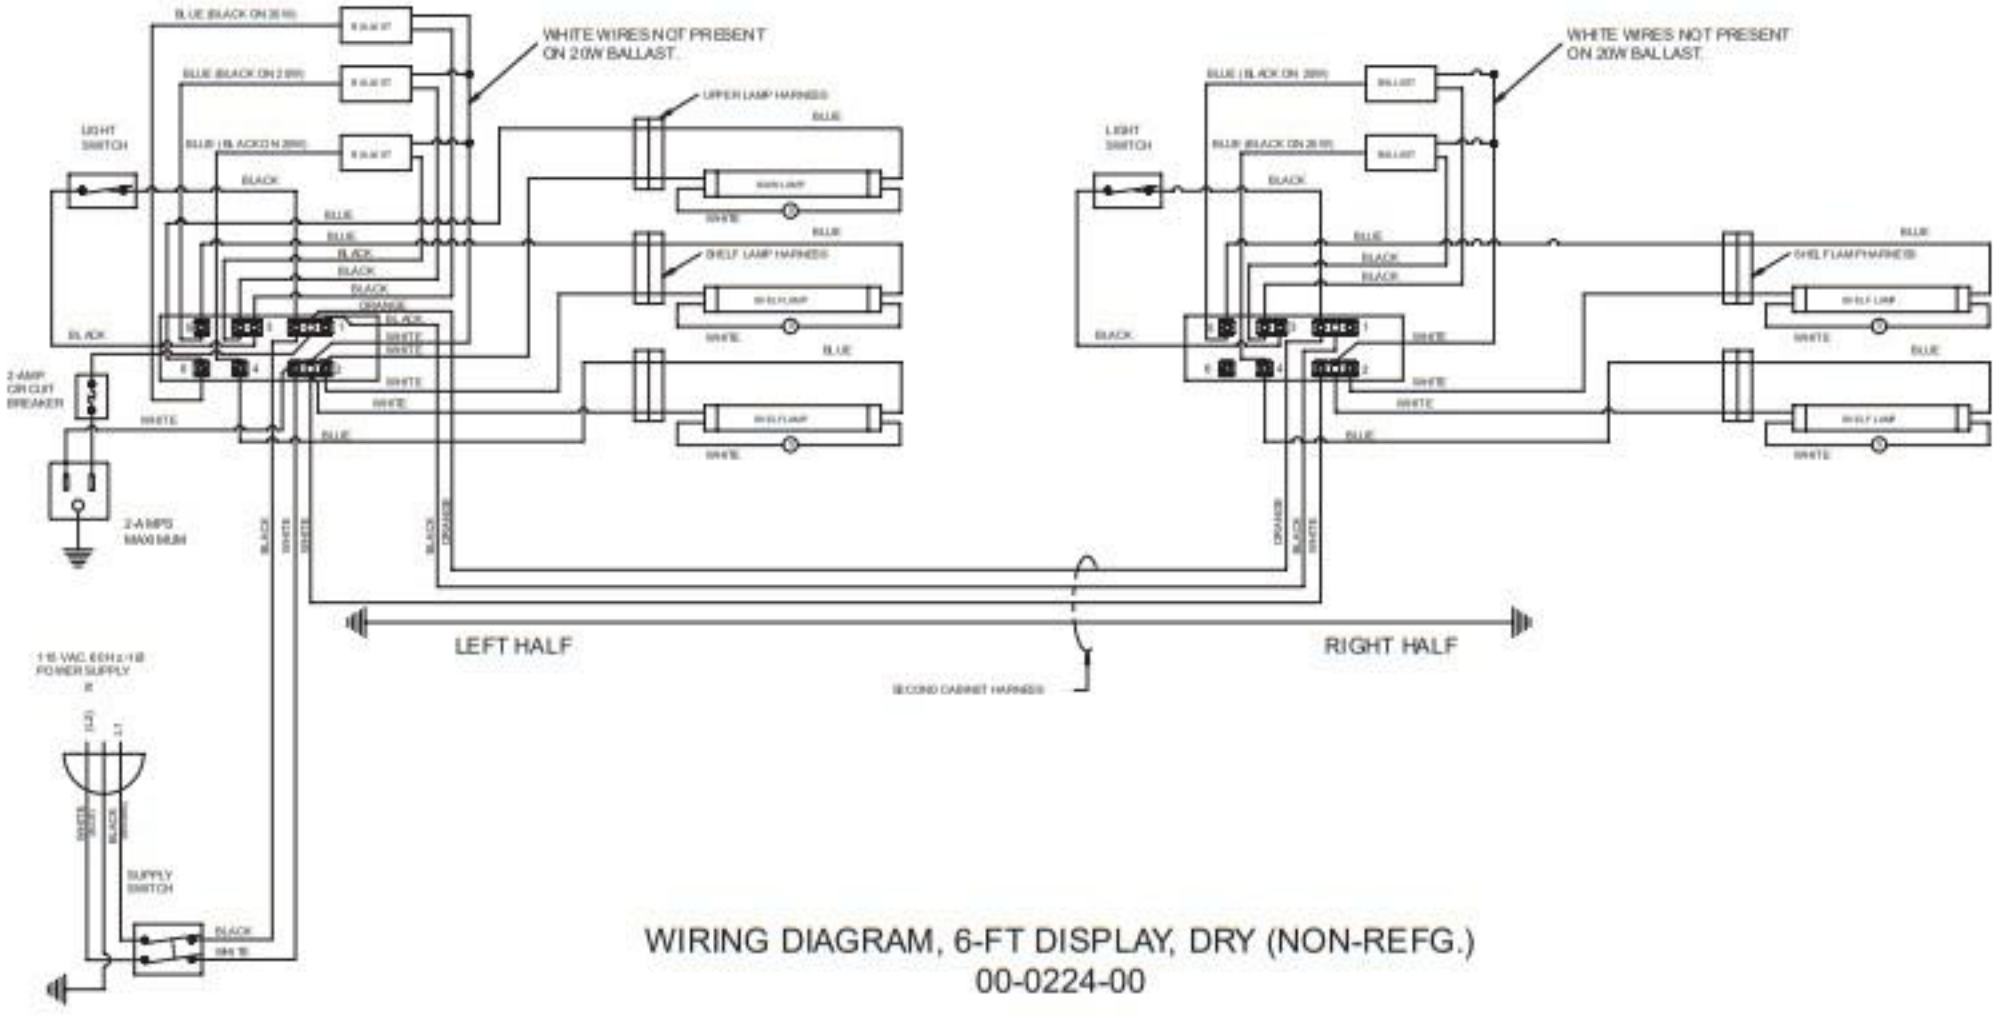

WIRING DIAGRAM, 6-FT DISPLAY, DRY (NON-REFG.)
00-0224-00

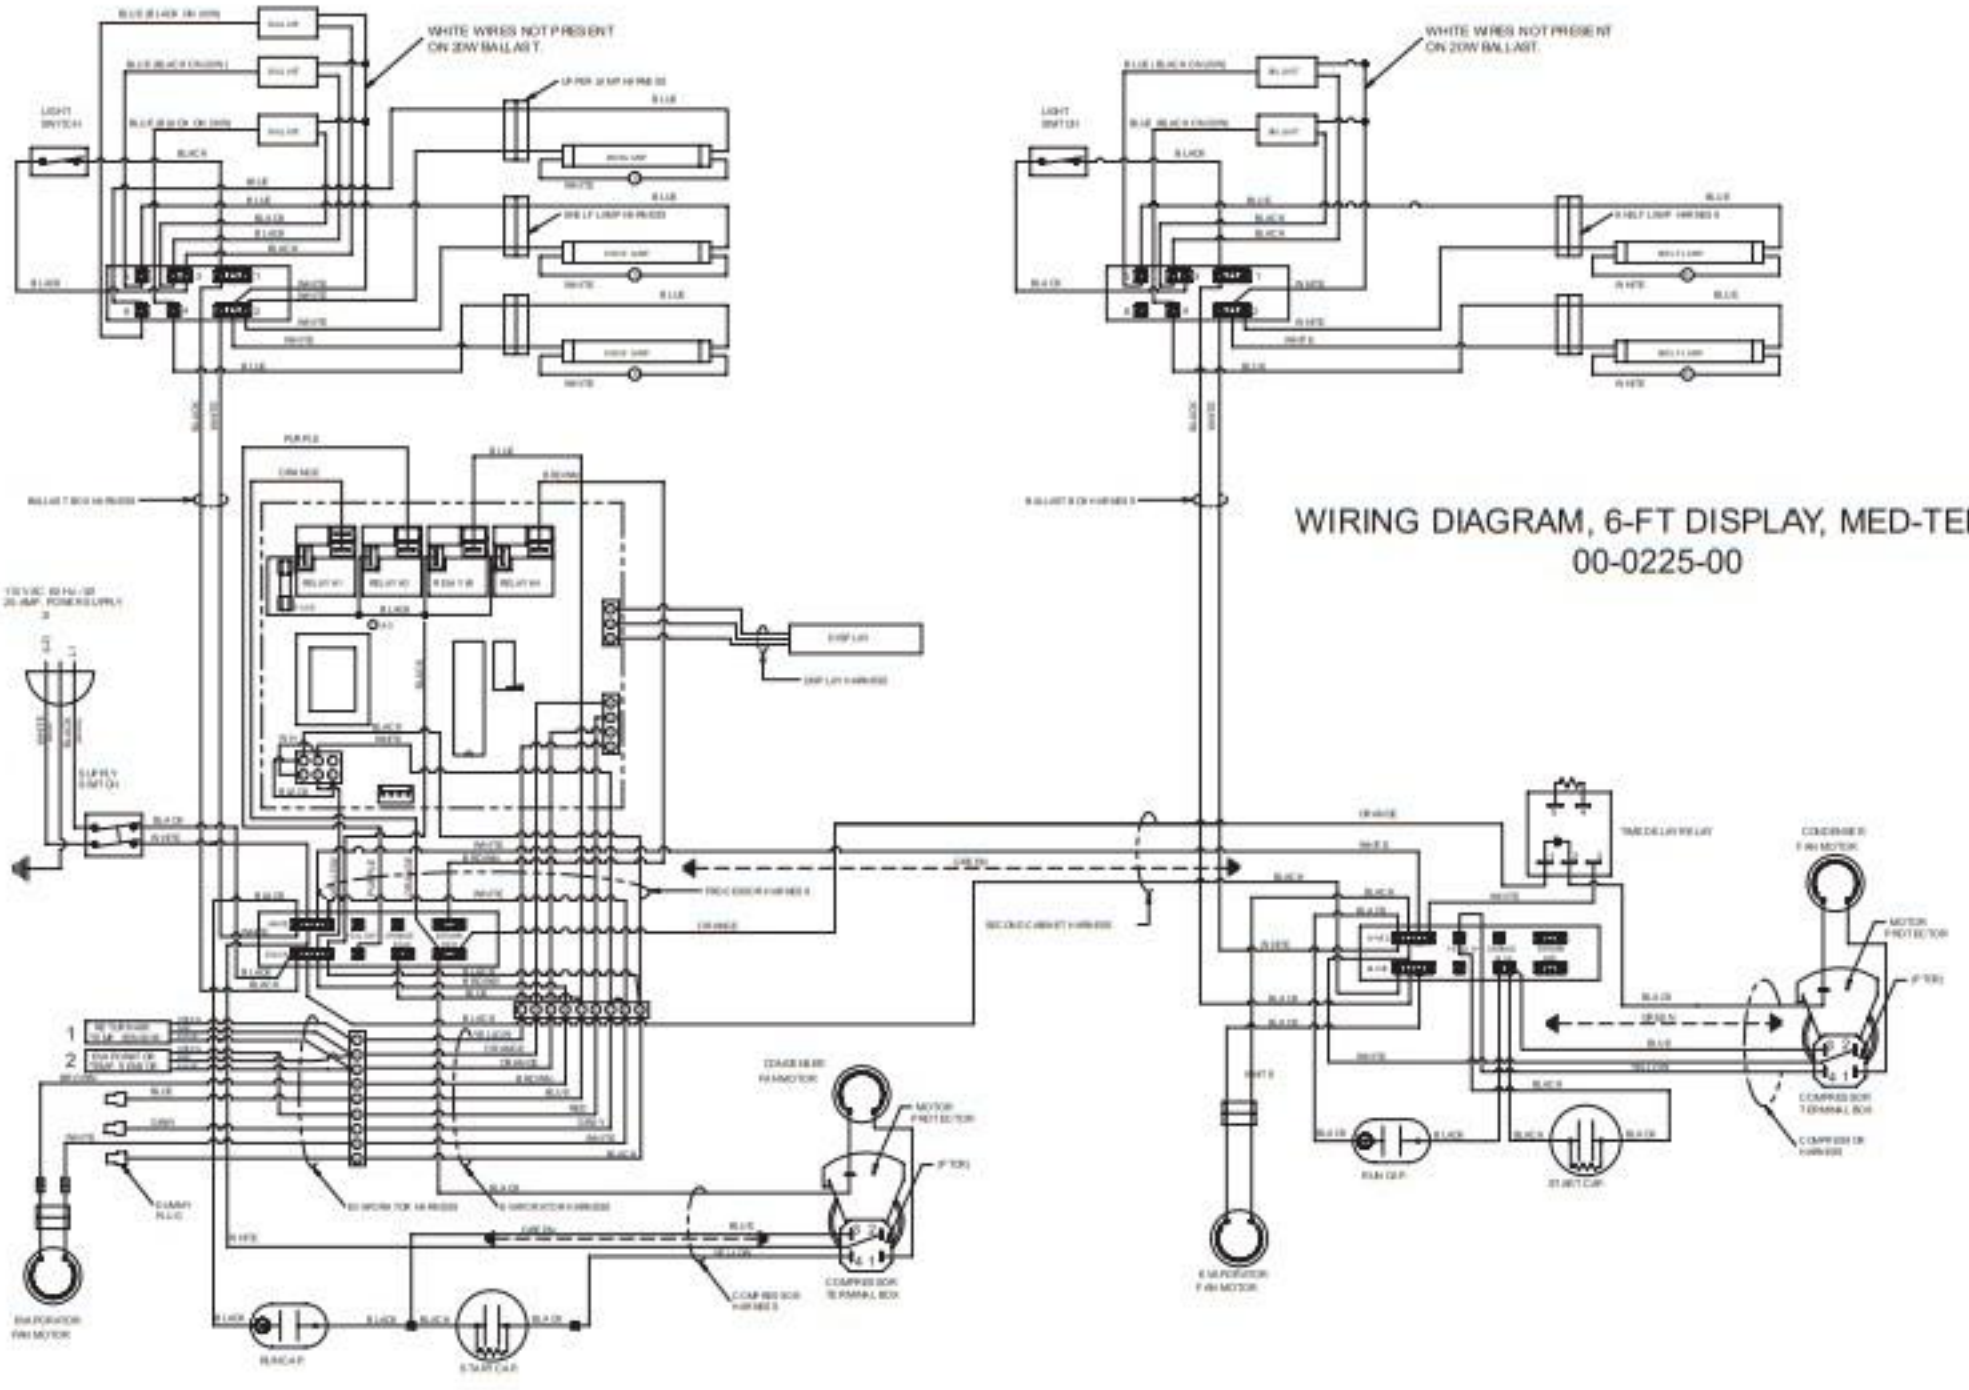
WHITE WIRES NOT PRESENT ON 20W BALLAST.
WHITE WIRES NOT PRESENT ON 20W BALLAST.
WIRING DIAGRAM, 6-FT DISPLAY, MED-TEMP.
00-0225-00

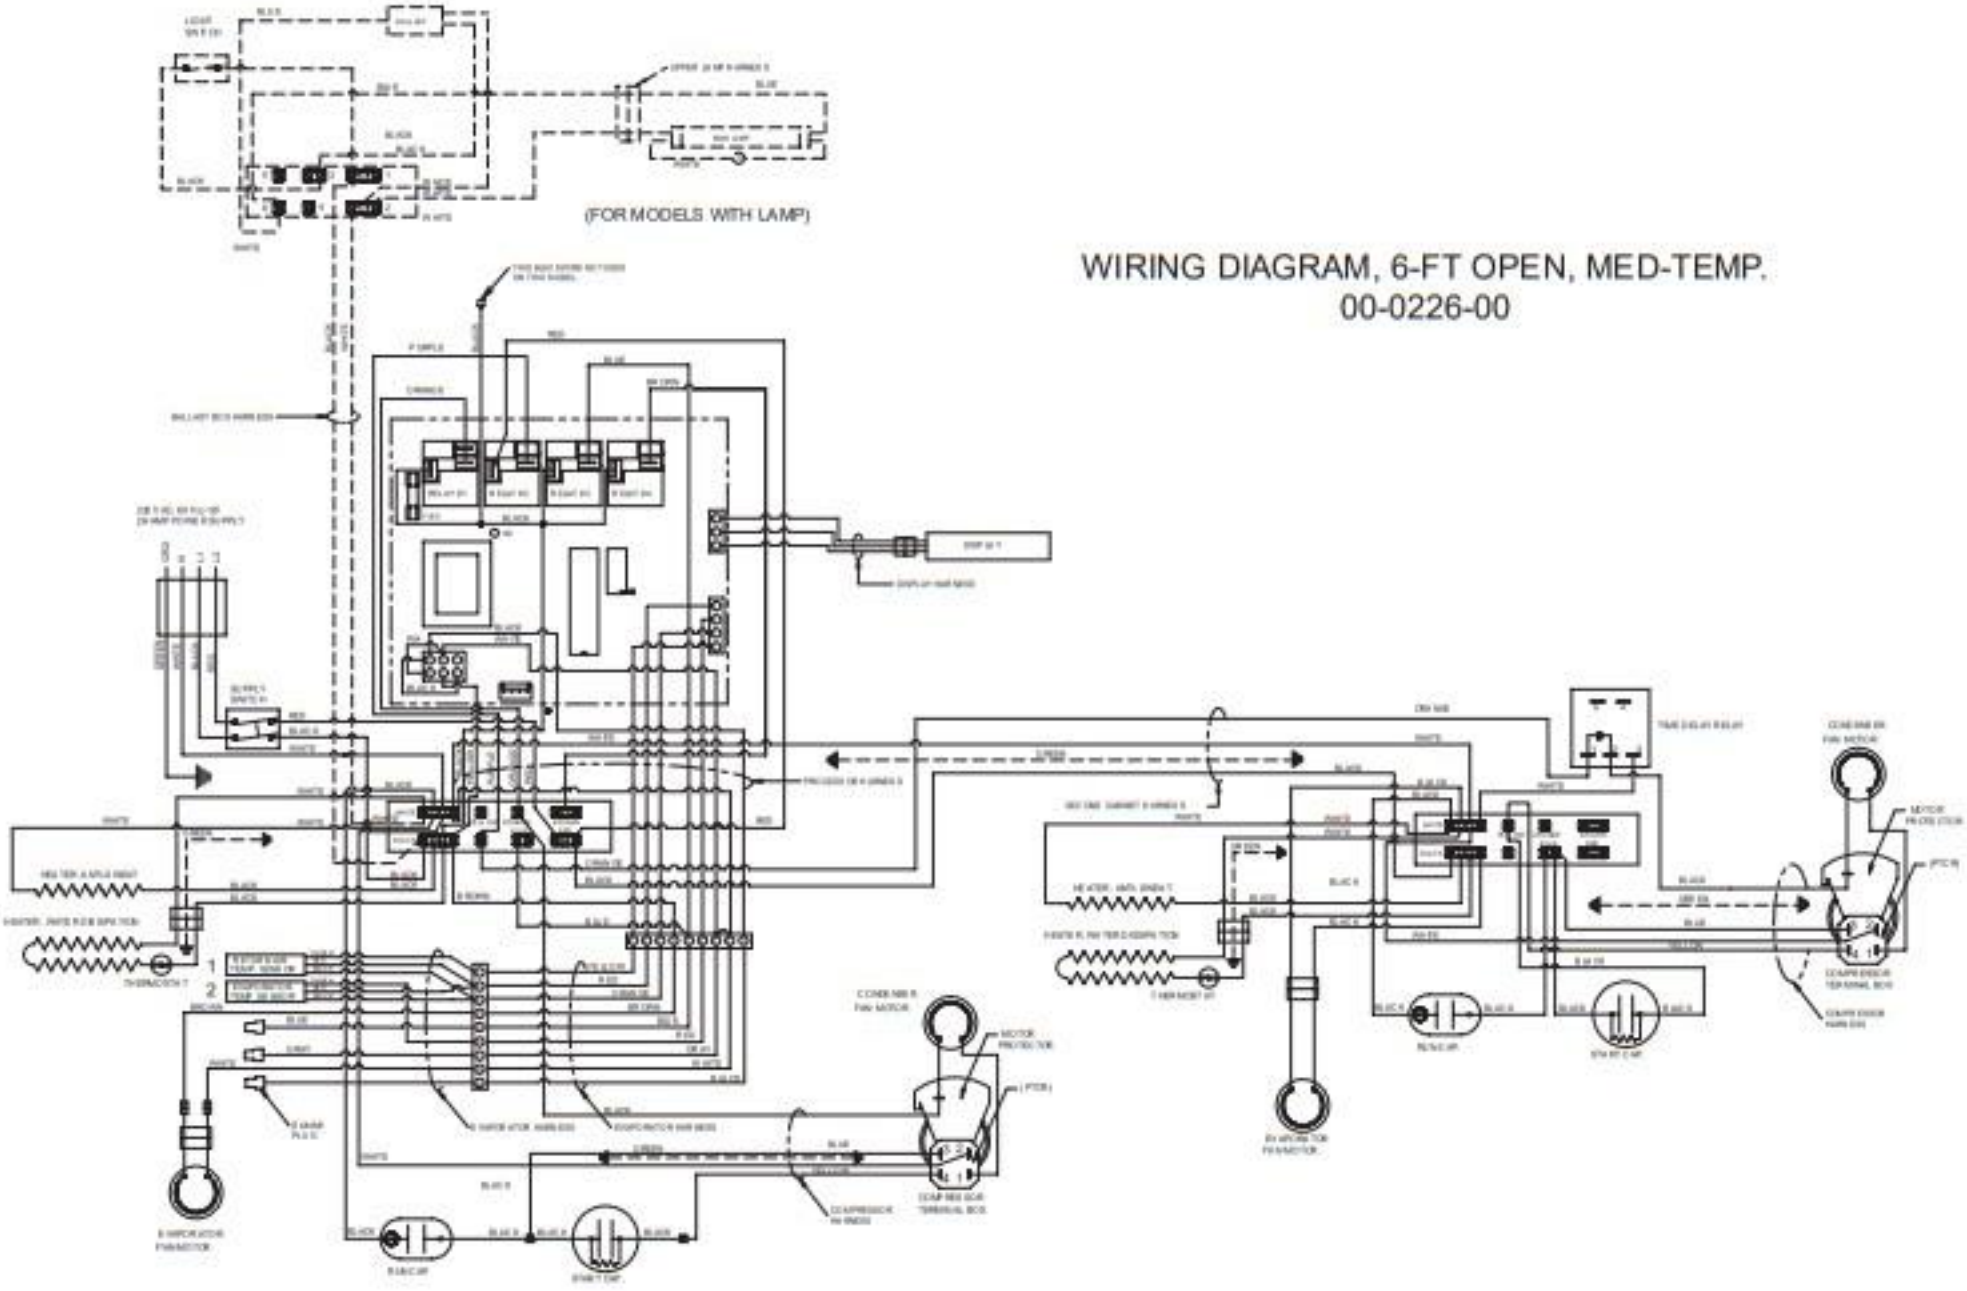

WIRING DIAGRAM, 6-FT OPEN, MED-TEMP.
00-0226-00

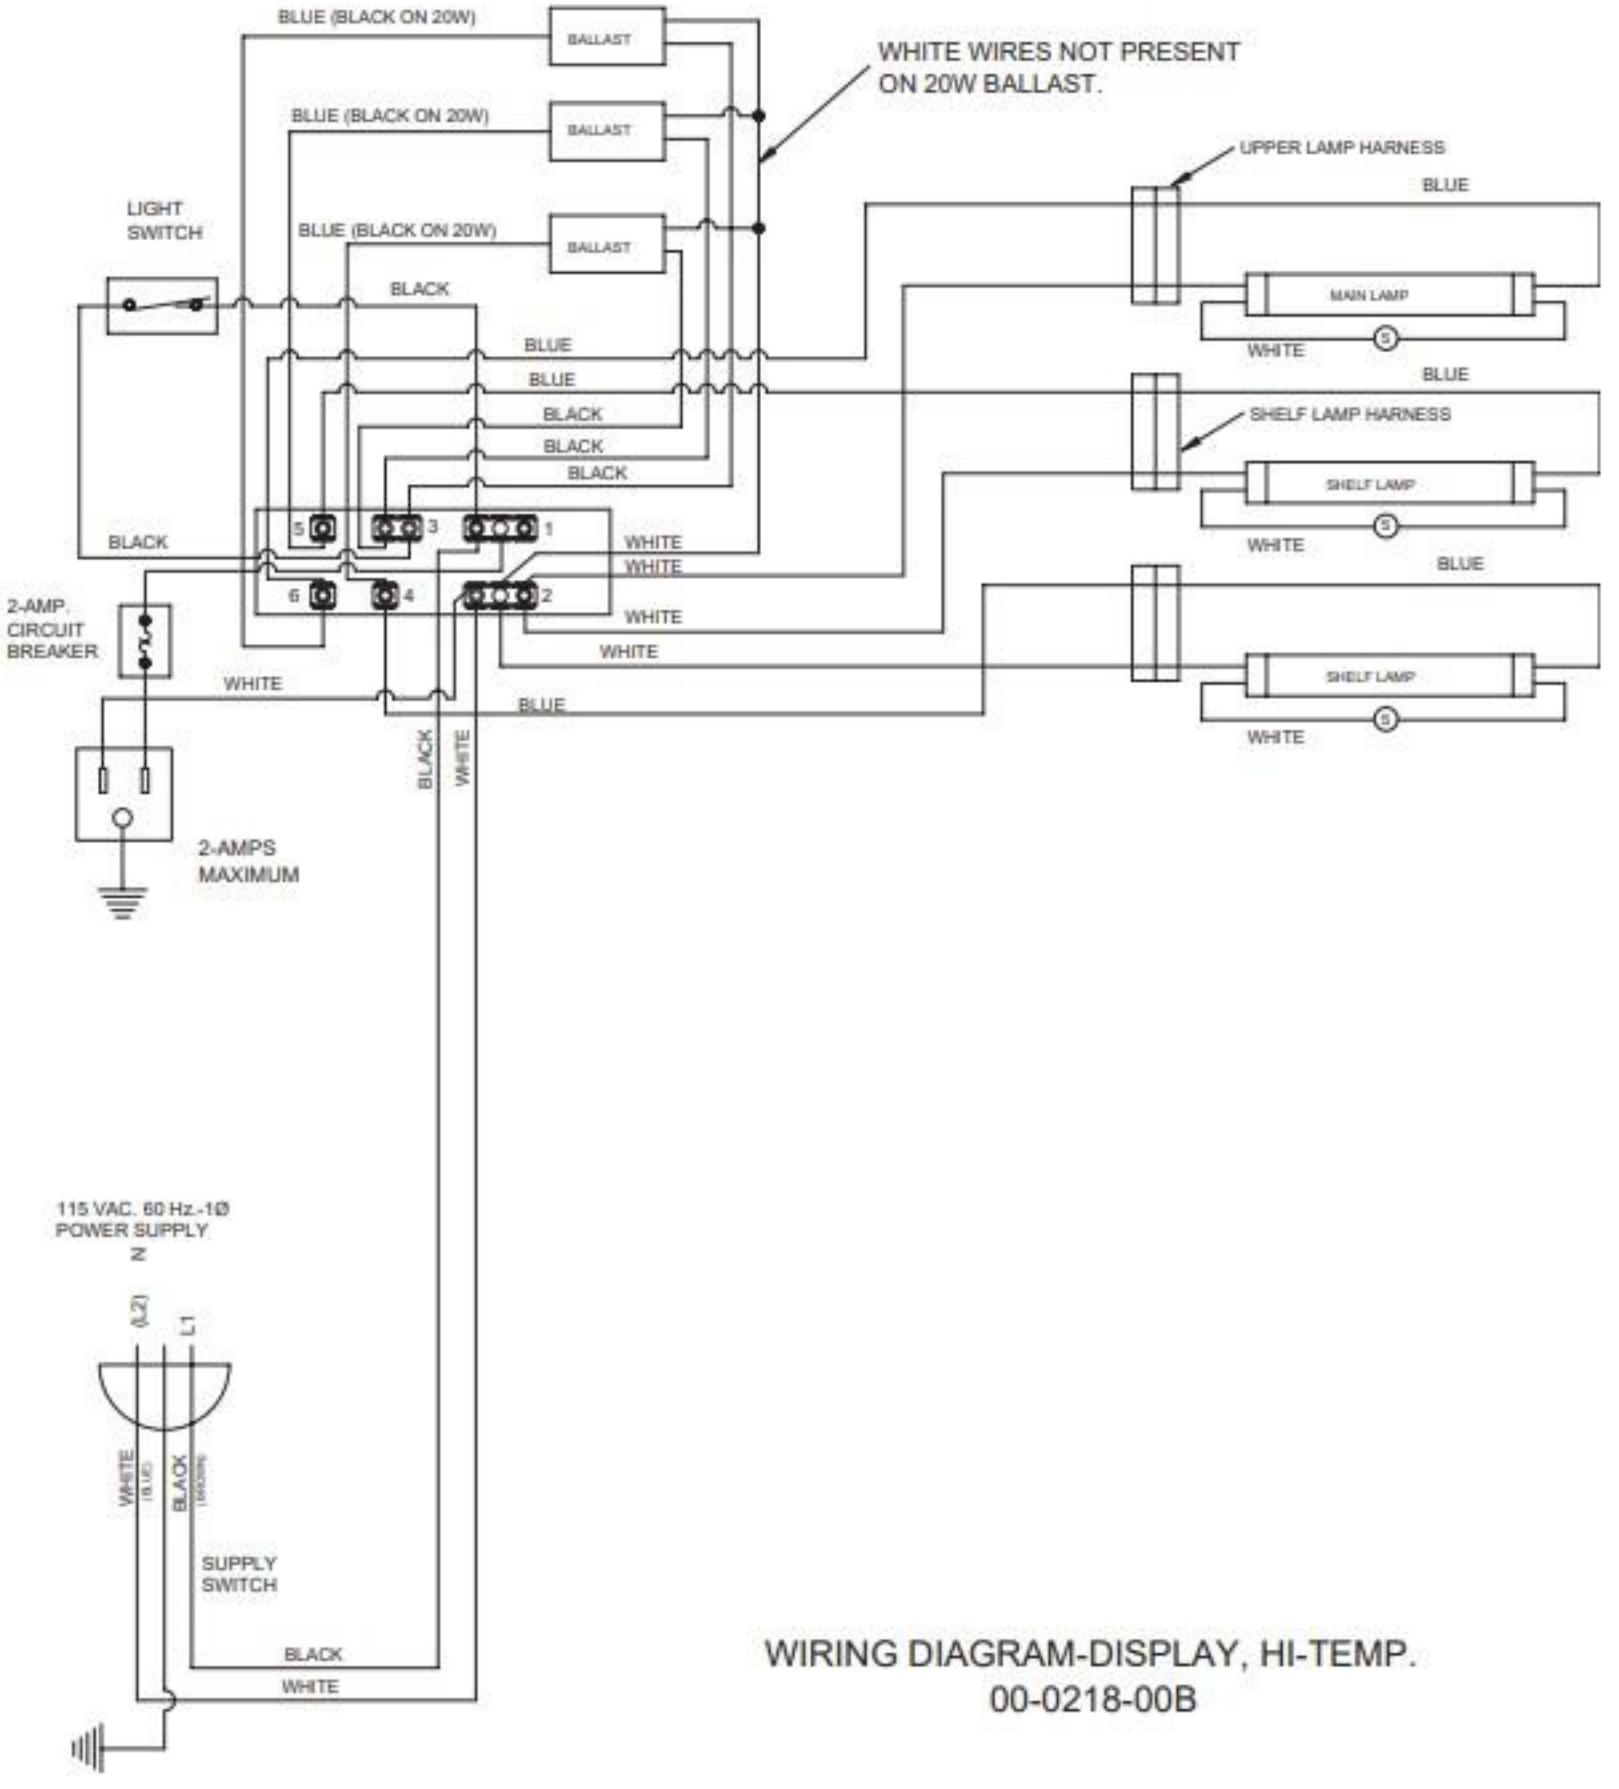

WIRING DIAGRAM-DISPLAY, HI-TEMP.
00-0218-00B

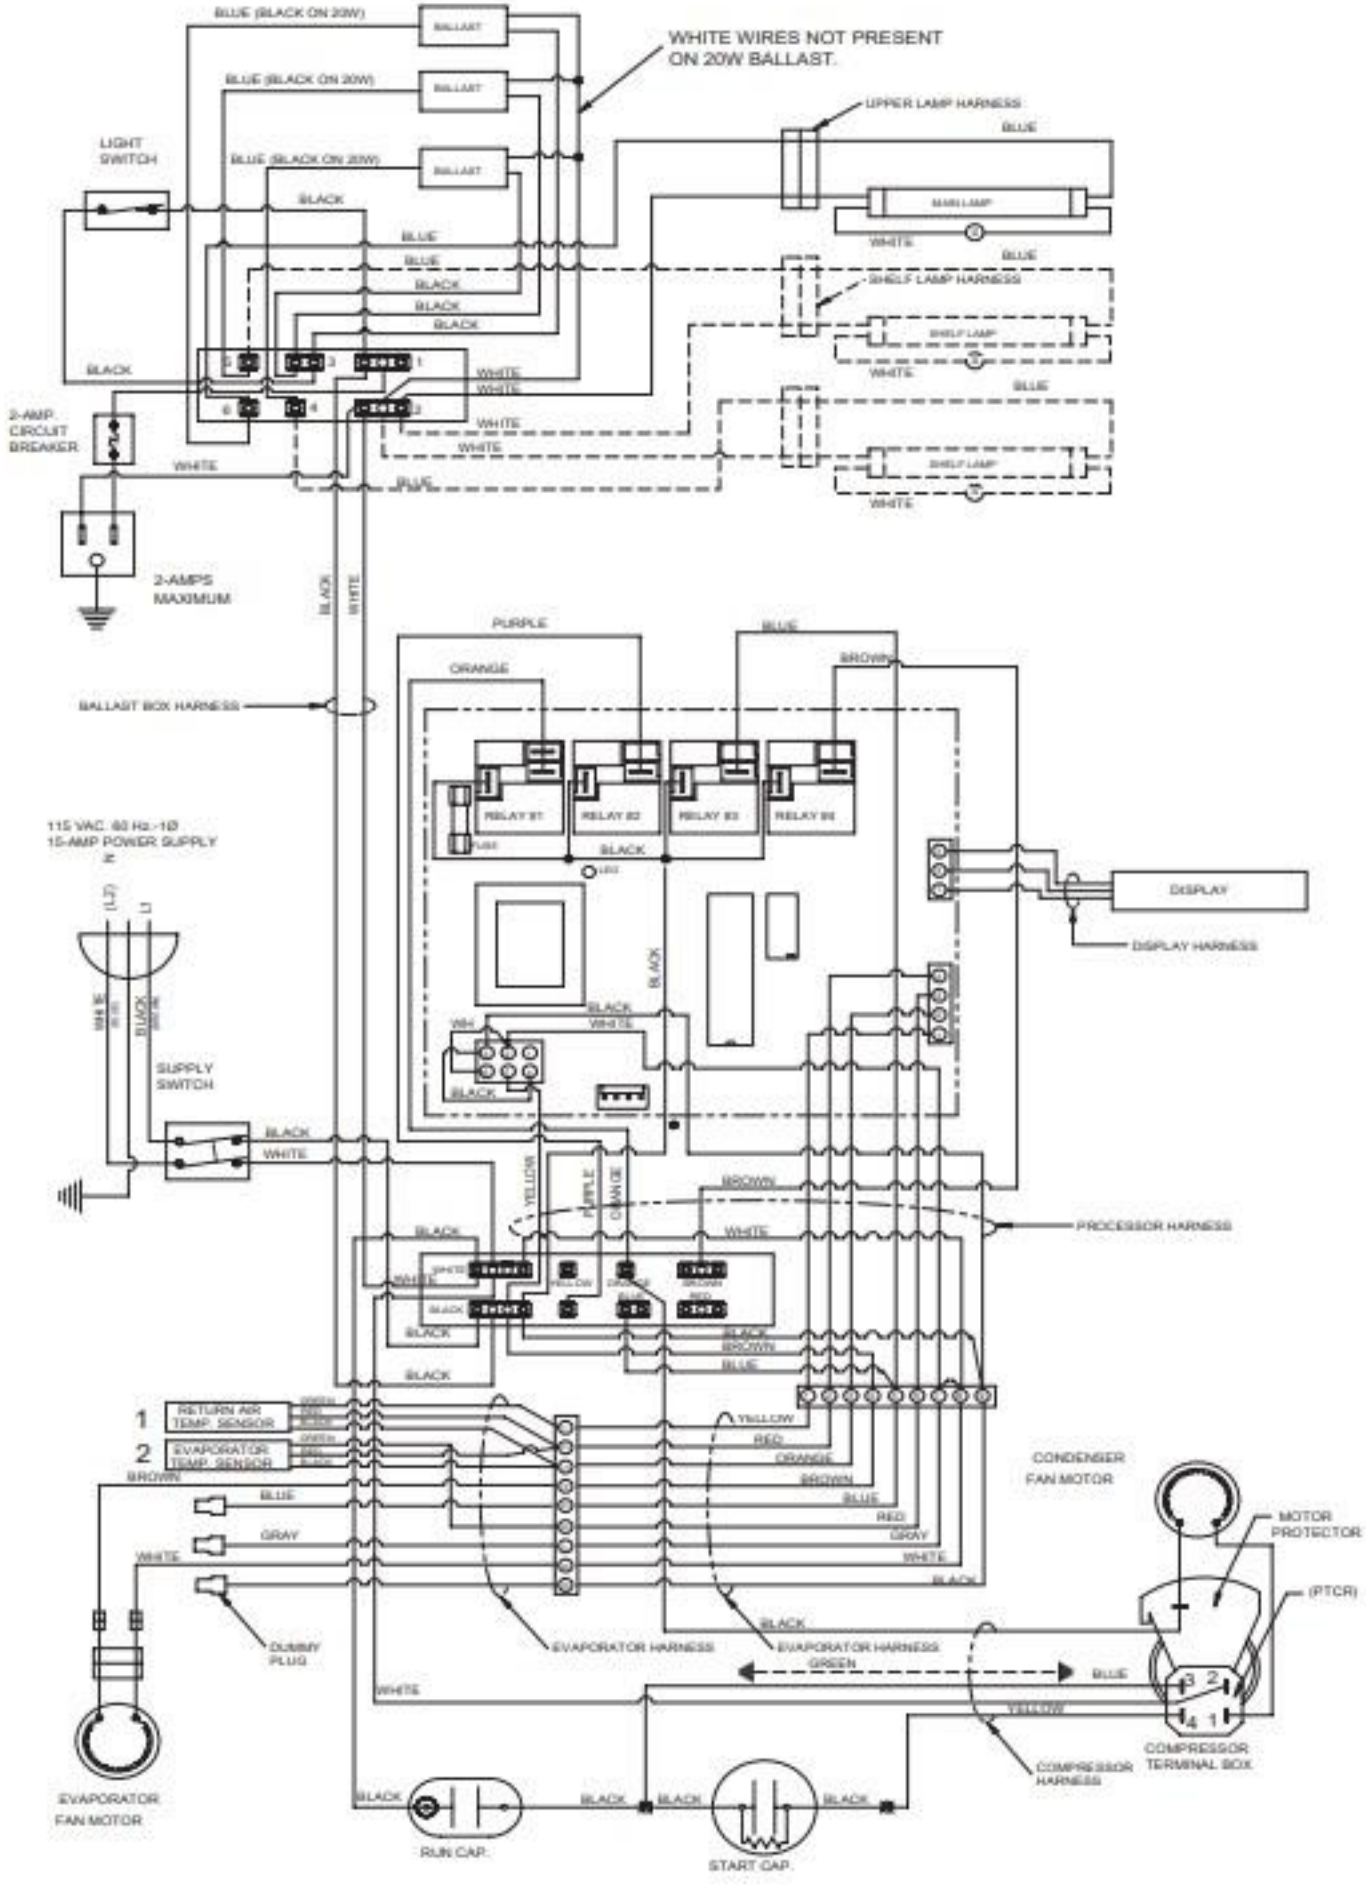
BLUE (BLACK ON 20W)
BALLAST
BLUE (BLACK ON 20W)
BALLAST
BLUE (BLACK ON 20W)
BALLAST
WHITE WIRES NOT PRESENT ON 20W BALLAST.
LIGHT SWITCH
BLACK
UPPER LAMP HARNESS
BLUE
MAIN LAMP
WHITE
BLUE
BLUE
BLACK
BLACK
BLACK
SHELF LAMP HARNESS
SHELF LAMP
WHITE
BLUE
SHELF LAMP
WHITE
BLACK
WHITE
WHITE
WHITE
WHITE
BLUE
2-AMP. CIRCUIT BREAKER
WHITE
2-AMPS MAXIMUM
BLACK
WHITE
PURPLE
BLUE
ORANGE
BROWN
BALLAST BOX HARNESS
RELAY B1
RELAY B2
RELAY B3
RELAY B4
BLACK
DISPLAY
DISPLAY HARNESS
115 VAC. 60 Hz.-1Ø
15-AMP POWER SUPPLY
BLACK
WHITE
BLACK
WHITE
SUPPLY SWITCH
BLACK
WHITE
YELLOW
PURPLE
ORANGE
BROWN
BLACK
WHITE
PROCESSOR HARNESS
BLACK
BLACK
BLACK
BROWN
BLUE
BLACK
1
RETURN AIR TEMP. SENSOR
2
EVAPORATOR TEMP. SENSOR
BROWN
BLUE
GRAY
WHITE
YELLOW
RED
ORANGE
BROWN
BLUE
RED
GRAY
WHITE
BLACK
CONDENSER FAN MOTOR
MOTOR PROTECTOR
(PTCR)
DUMMY PLUG
EVAPORATOR HARNESS
EVAPORATOR HARNESS
BLACK
GREEN
BLUE
WHITE
YELLOW
3 2
4 1
COMPRESSOR TERMINAL BOX
COMPRESSOR HARNESS
EVAPORATOR FAN MOTOR
BLACK
BLACK
BLACK
BLACK
RUN CAP.
START CAP.

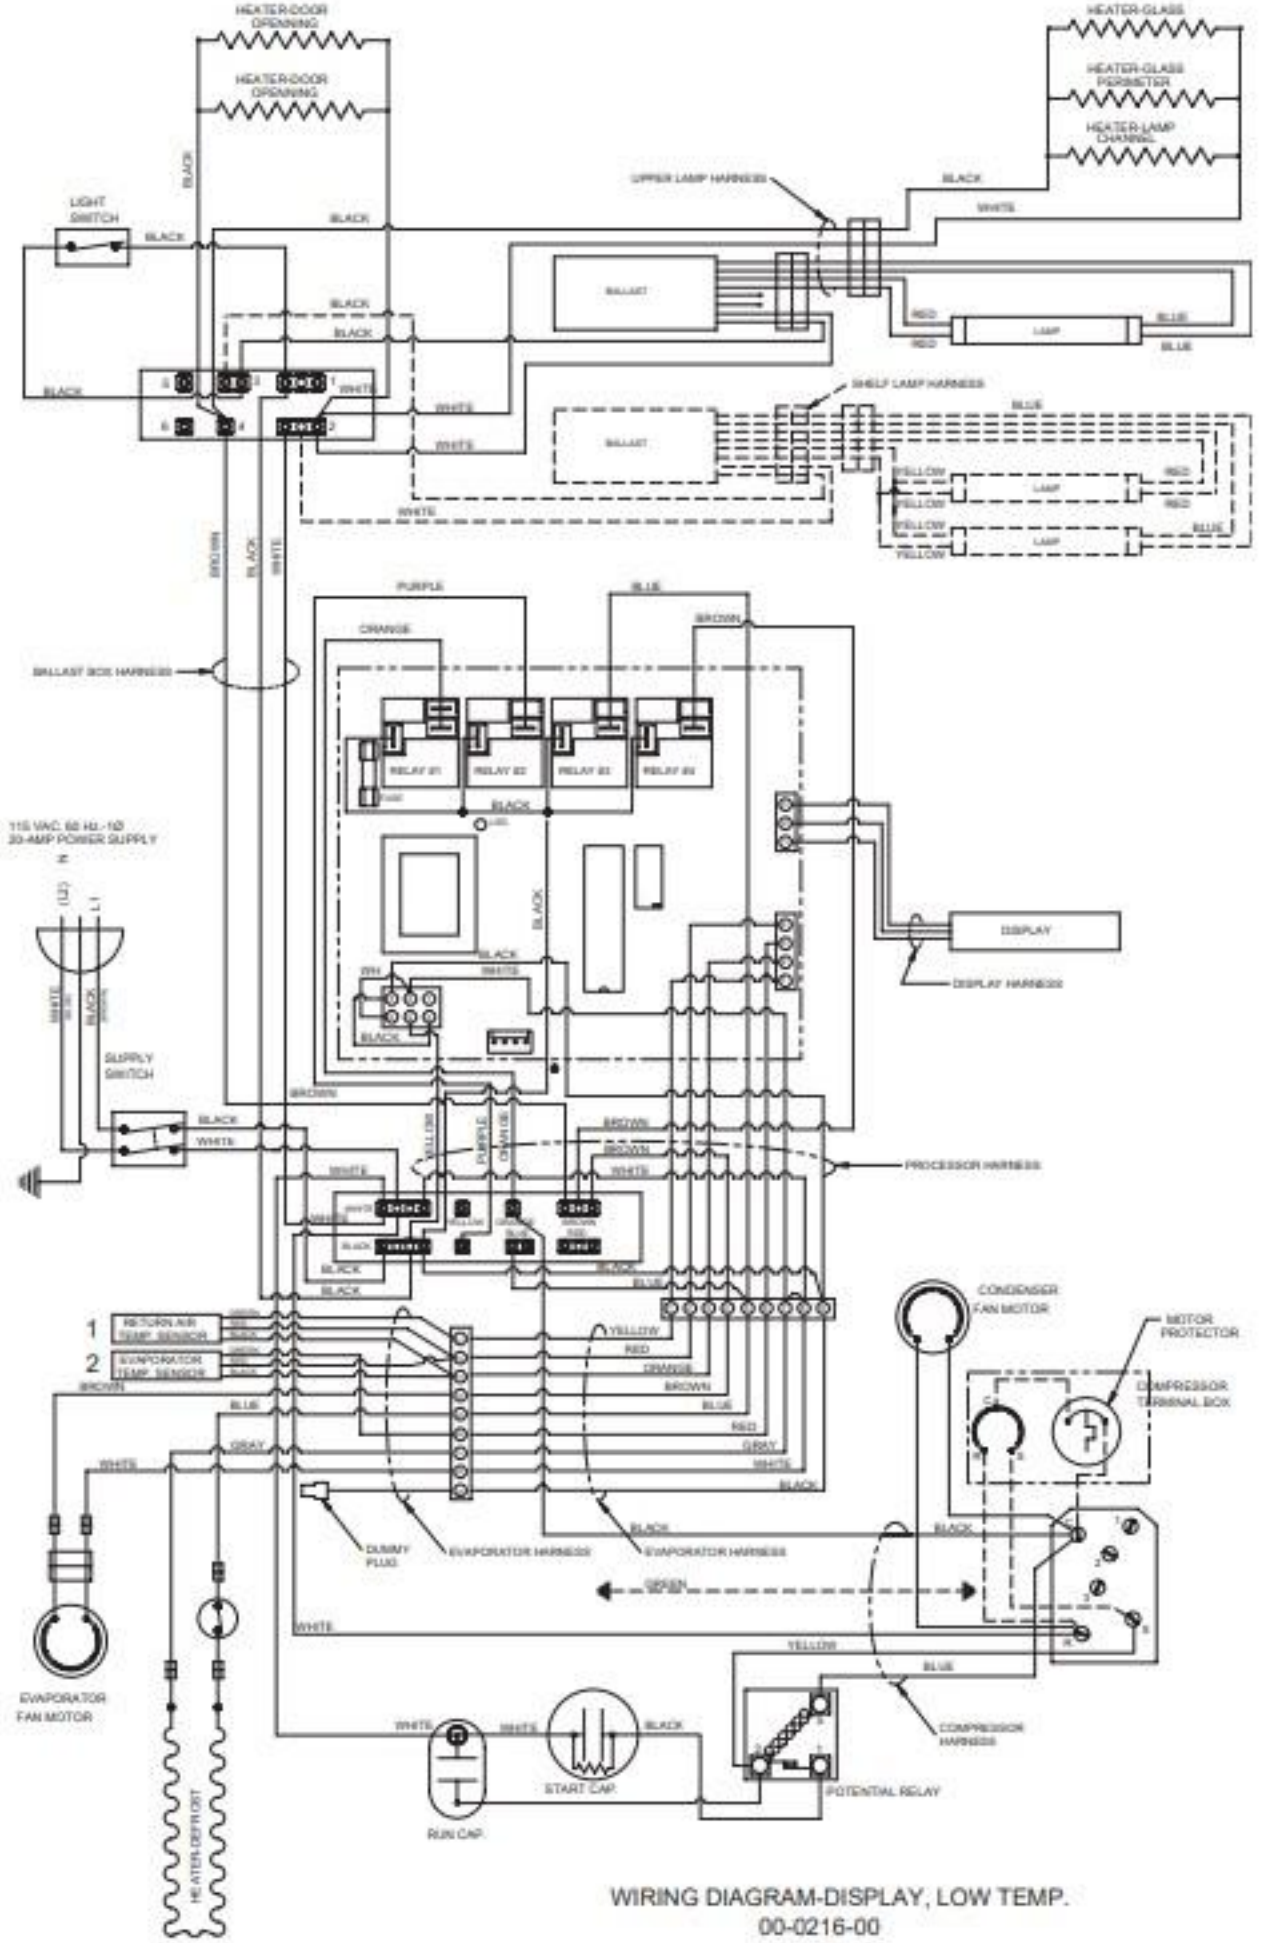

WIRING DIAGRAM-DISPLAY, LOW TEMP.
00-0216-00

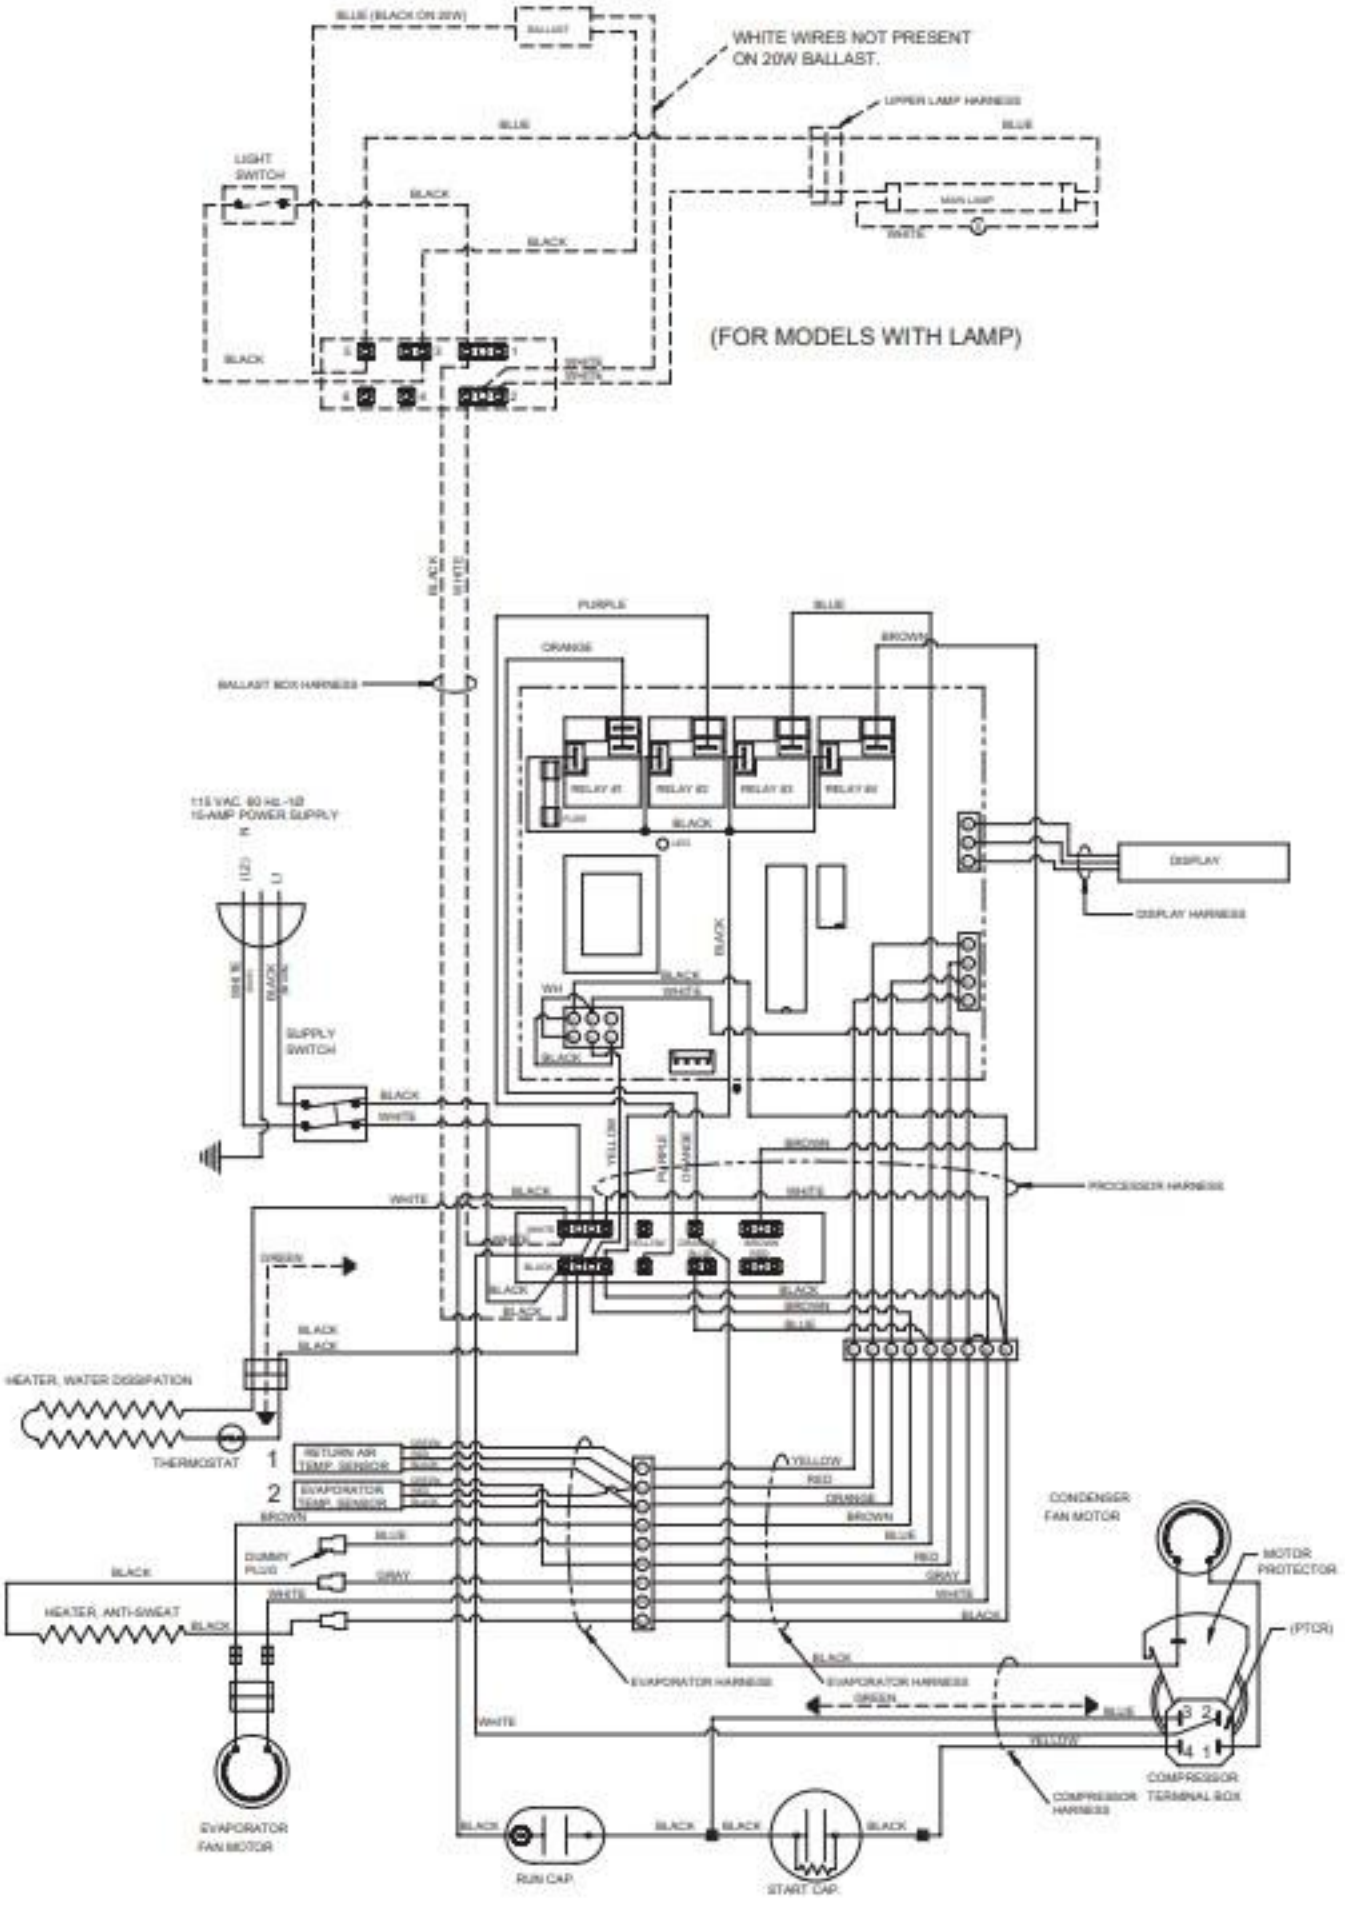
WHITE WIRES NOT PRESENT ON 20W BALLAST.
(FOR MODELS WITH LAMP)
BALLAST BOX HARNESS
DISPLAY
DISPLAY HARNESS
PROCESSOR HARNESS
SUPPLY SWITCH
HEATER, WATER DISSIPATION
THERMOSTAT
RETURN AIR TEMP. SENSOR
EVAPORATOR TEMP. SENSOR
DUMMY PLUG
HEATER, ANTI-SWEAT
EVAPORATOR HARNESS
EVAPORATOR FAN MOTOR
RUN CAP
START CAP
CONDENSER FAN MOTOR
MOTOR PROTECTOR
(PTCR)
COMPRESSOR TERMINAL BOX
COMPRESSOR HARNESS