



FOR SUPPLY CONNECTIONS USE COPPER WIRE ONLY, SUITABLE FOR
AT LEAST 90°C (194°F). USE #8 AWG OR LARGER. DO NOT CONNECT
TO A SYSTEM OPERATING AT MORE THAN 250 VOLTS TO GROUND

760T 230/400 VOLT Y - 21.75 KW			
NOM. AMPS PER LINE	X	Y	Z
	31.5	31.5	31.5

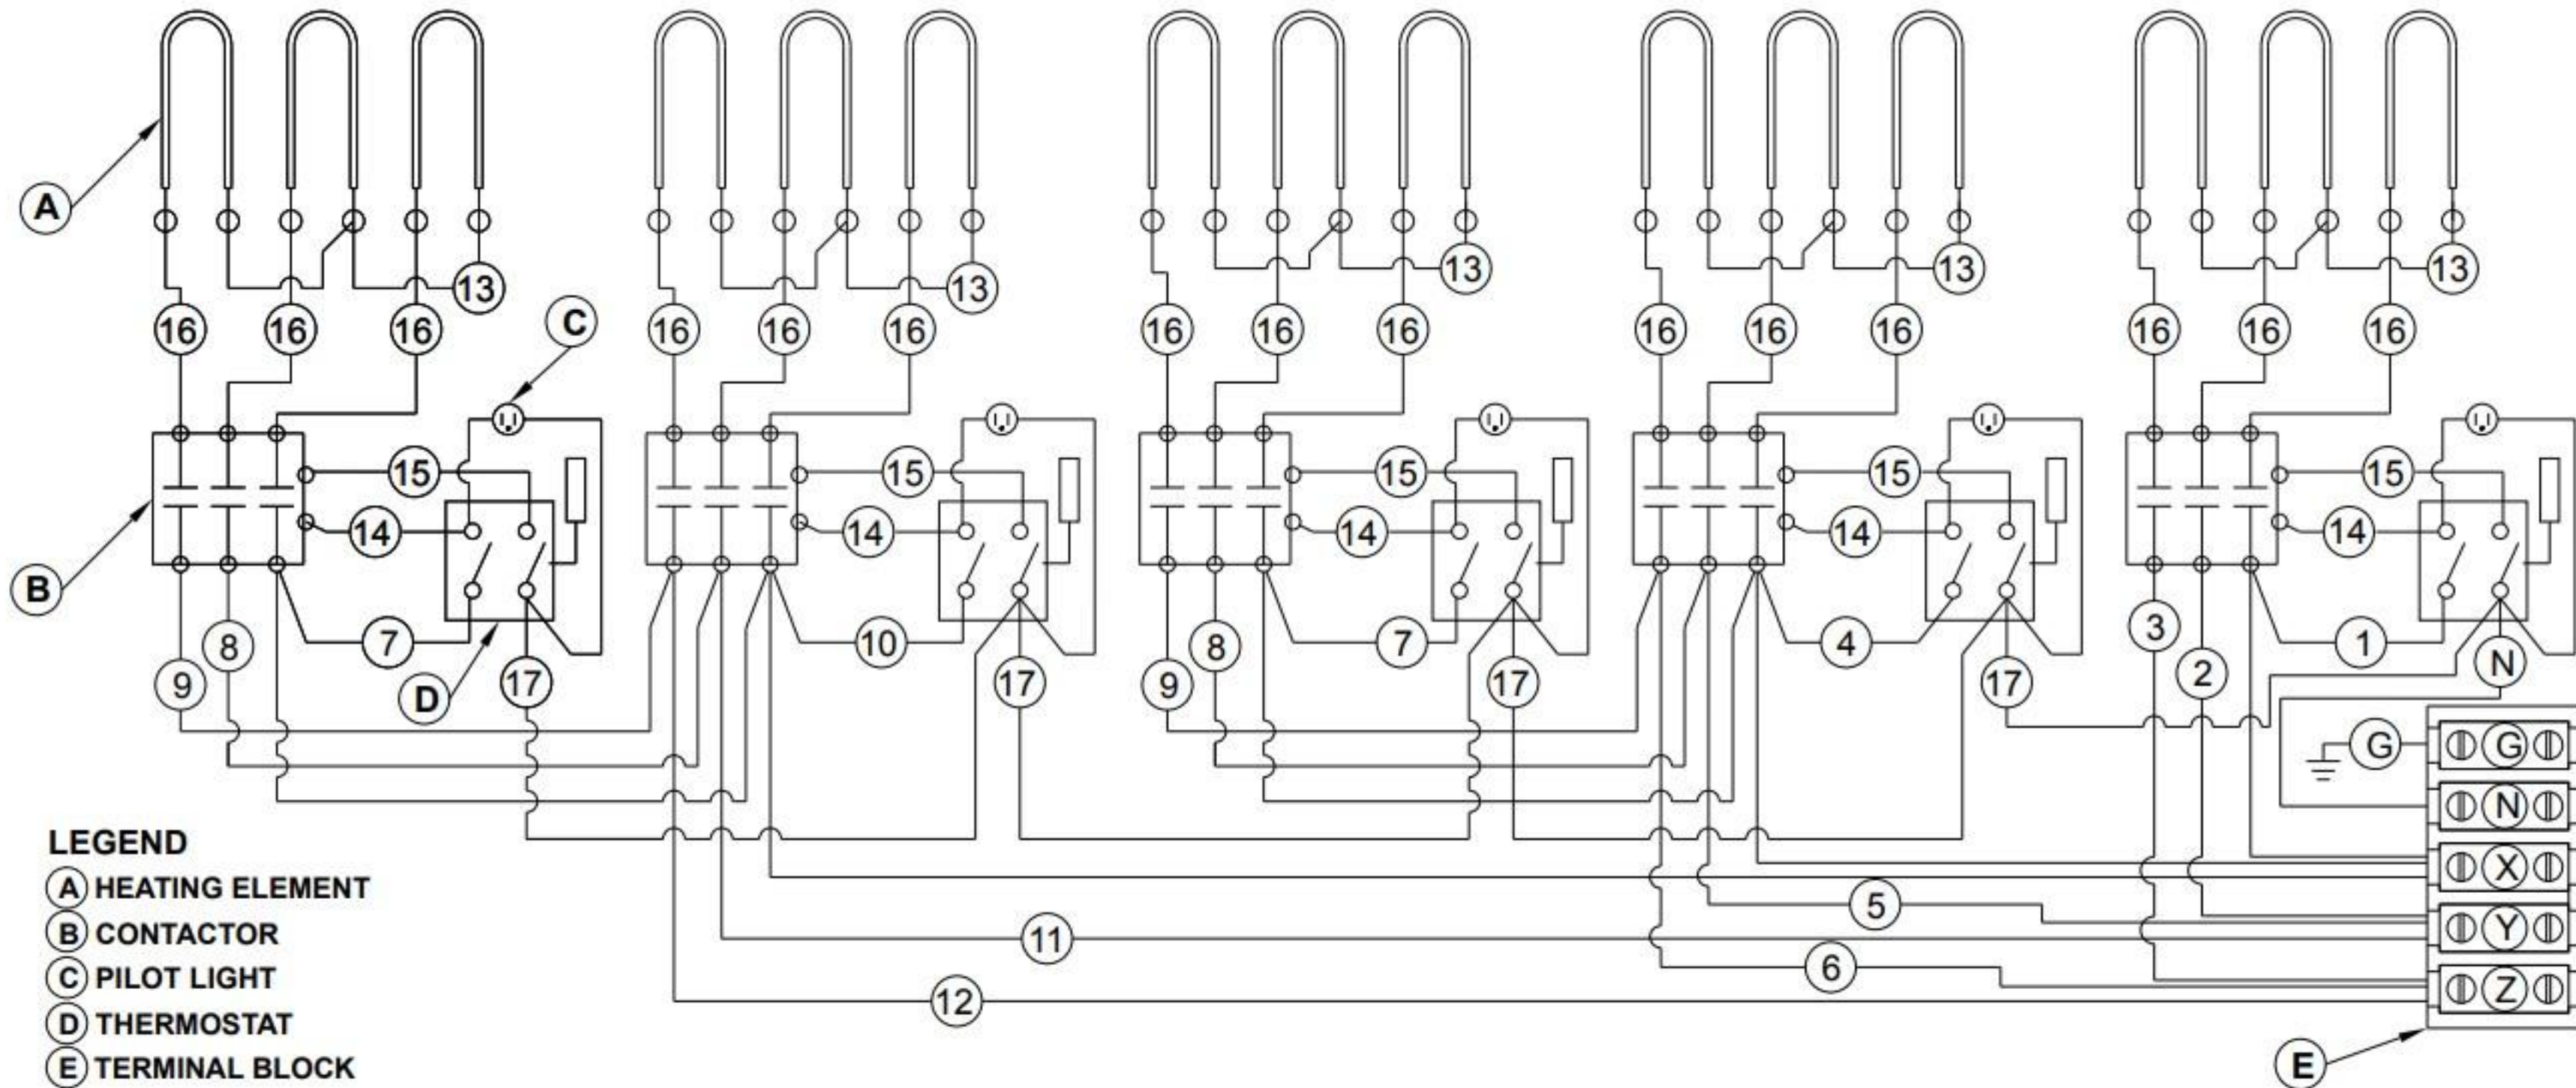


FOR SUPPLY CONNECTIONS USE COPPER WIRE ONLY, SUITABLE FOR AT LEAST 90°C (194°F). USE #8 AWG OR LARGER. DO NOT CONNECT TO A SYSTEM OPERATING AT MORE THAN 250 VOLTS TO GROUND

230/400 VOLT Y - 17.4 KW			
NOM. AMPS PER LINE	X	Y	Z
	25.2	25.2	25.2

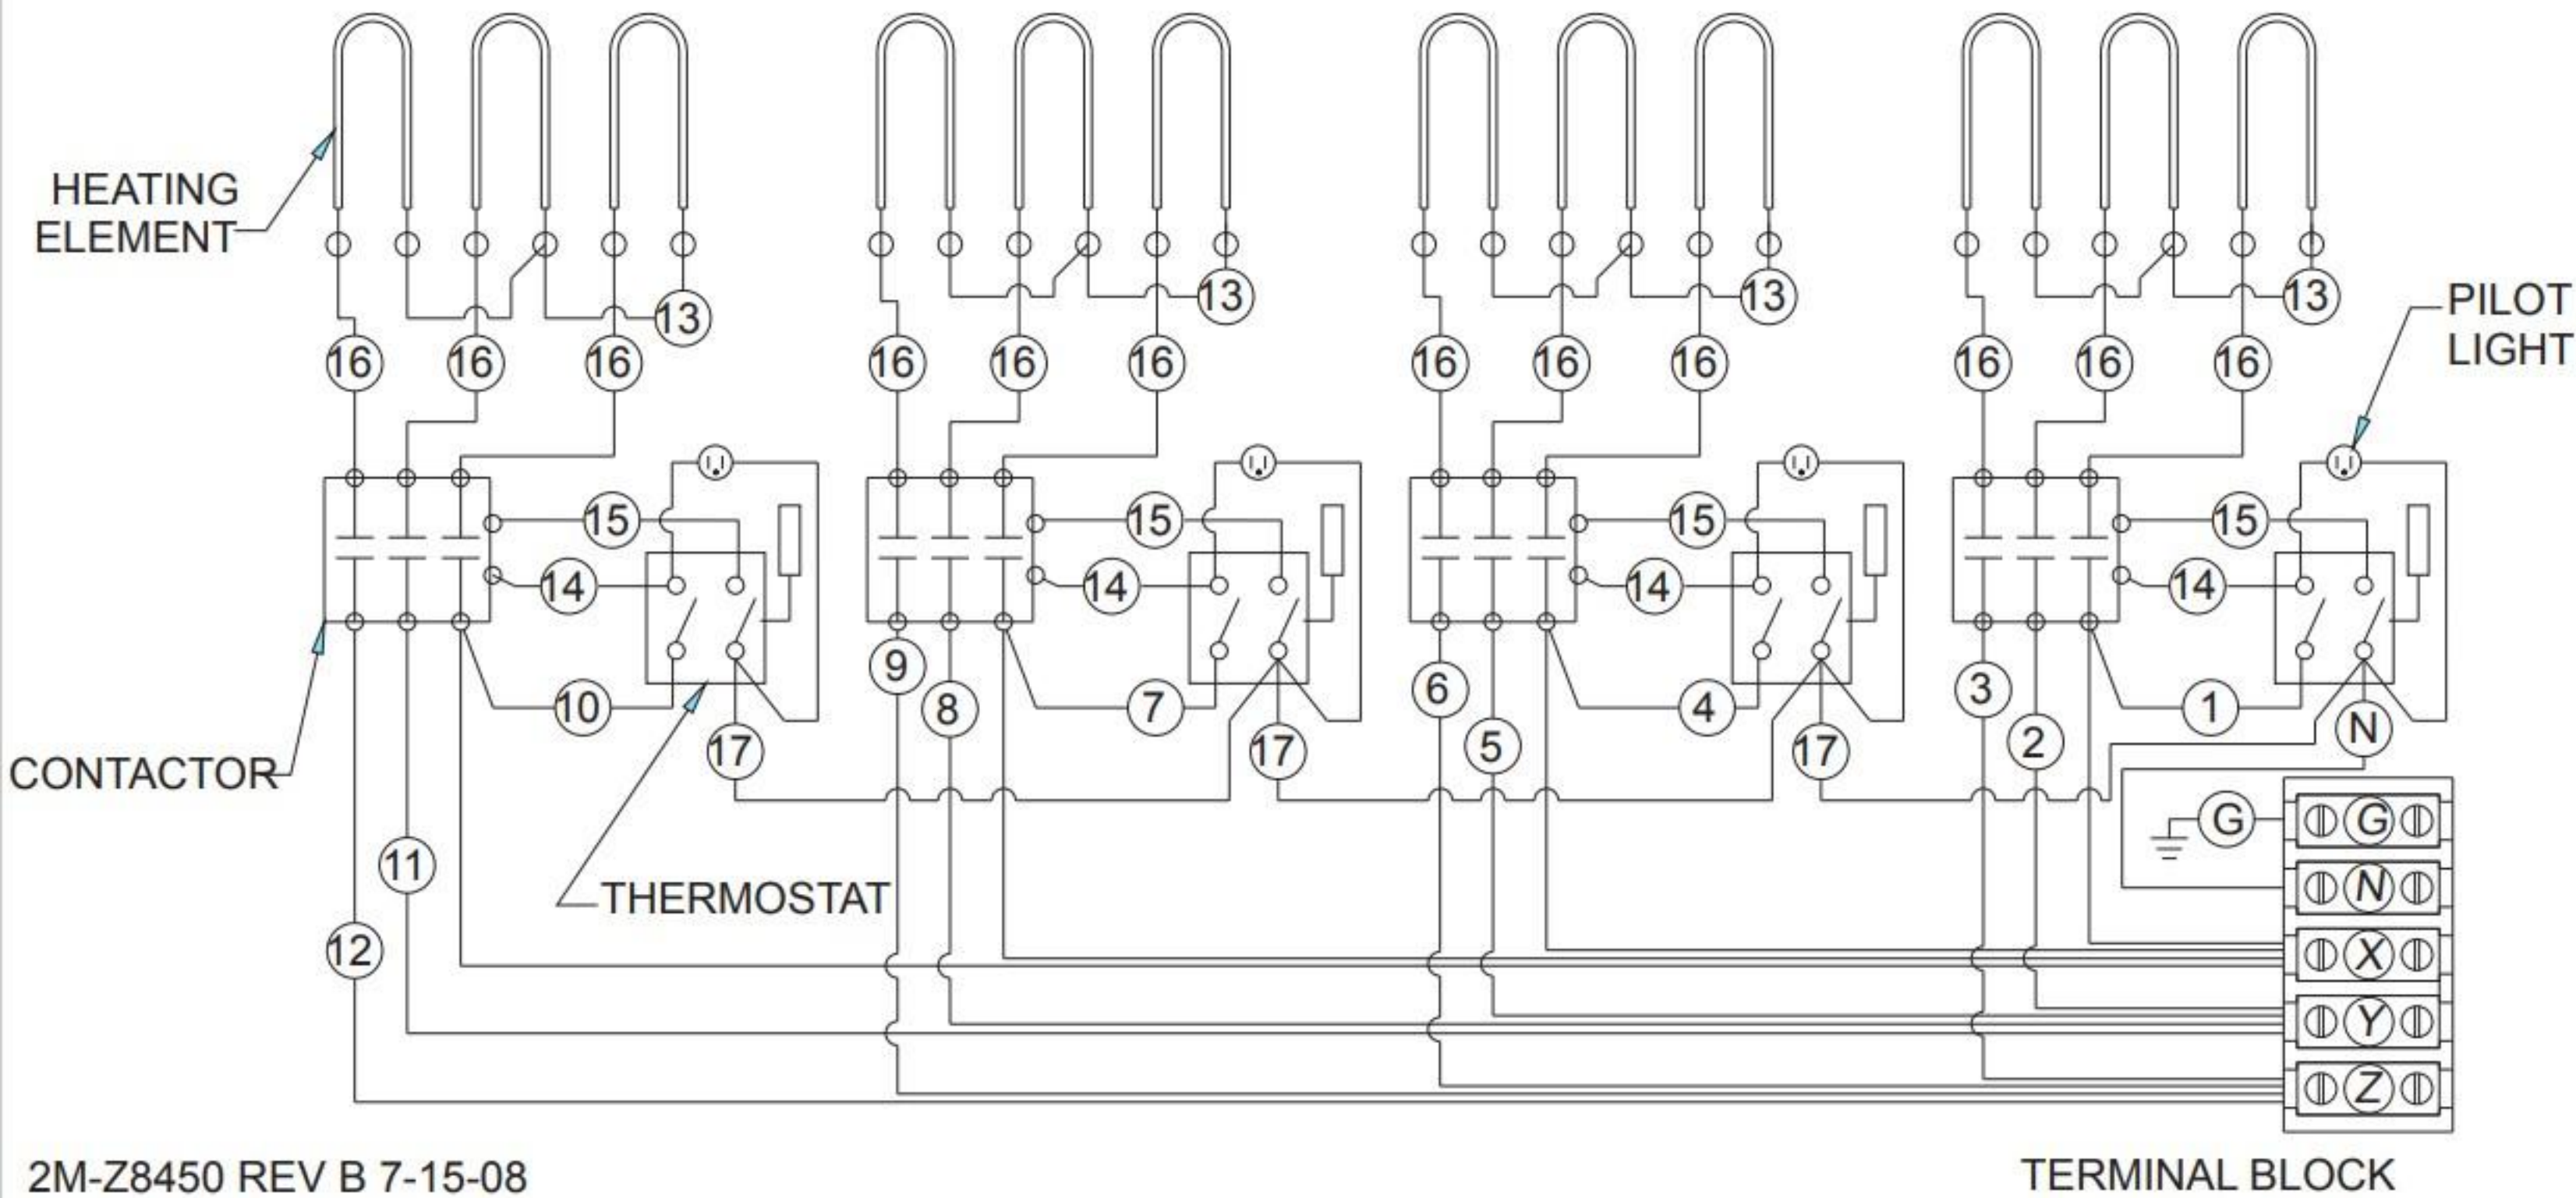


FOR SUPPLY CONNECTIONS USE COPPER WIRE ONLY, SUITABLE FOR AT LEAST 90°C (194°F).
USE #6 AWG OR LARGER. DO NOT CONNECT TO A SYSTEM OPERATING AT MORE THAN 250
VOLTS TO GROUND

230/400 VOLT Y - 13.05 KW			
NOM. AMPS PER LINE	X	Y	Z
	32.7	32.7	32.7

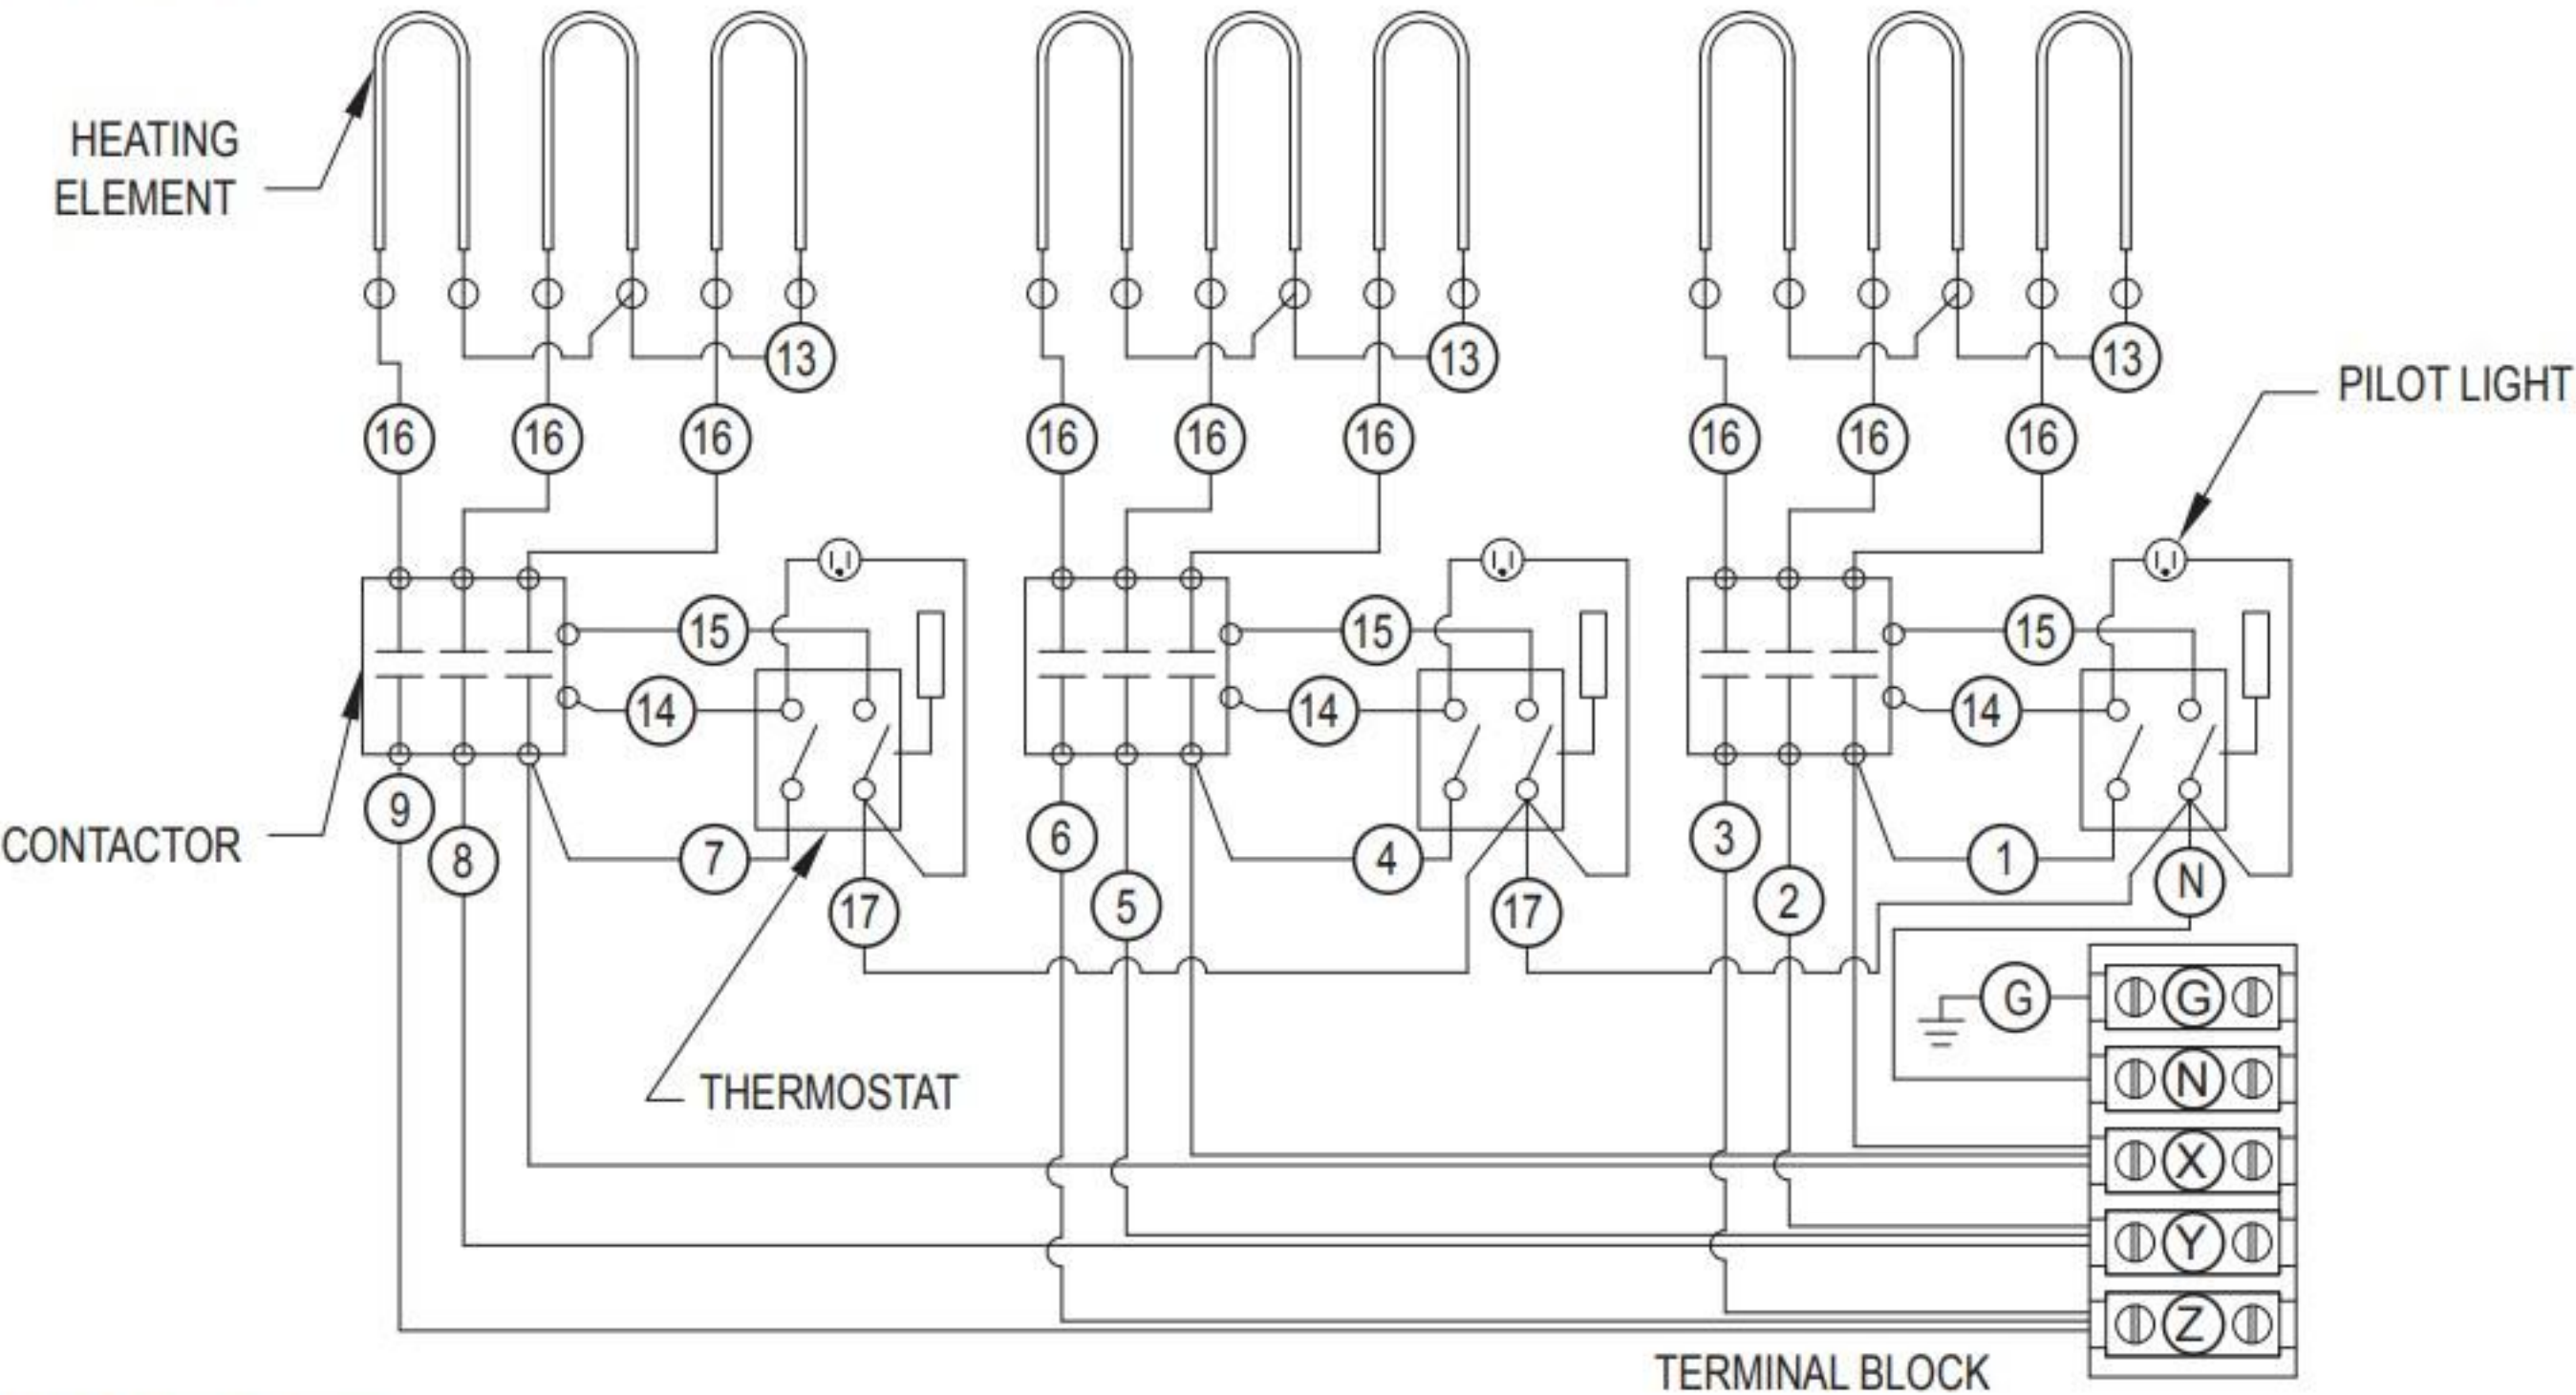


FOR SUPPLY CONNECTIONS USE COPPER WIRE ONLY, SUITABLE FOR AT LEAST 90°C (194 °F). USE #12 AWG OR LARGER. DO NOT CONNECT TO A SYSTEM OPERATING AT MORE THAN 250 VOLTS TO GROUND


230/400 VOLT Y - 8.7 KW			
NOM. AMPS PER LINE	X	Y	Z
	12.6	12.6	12.6

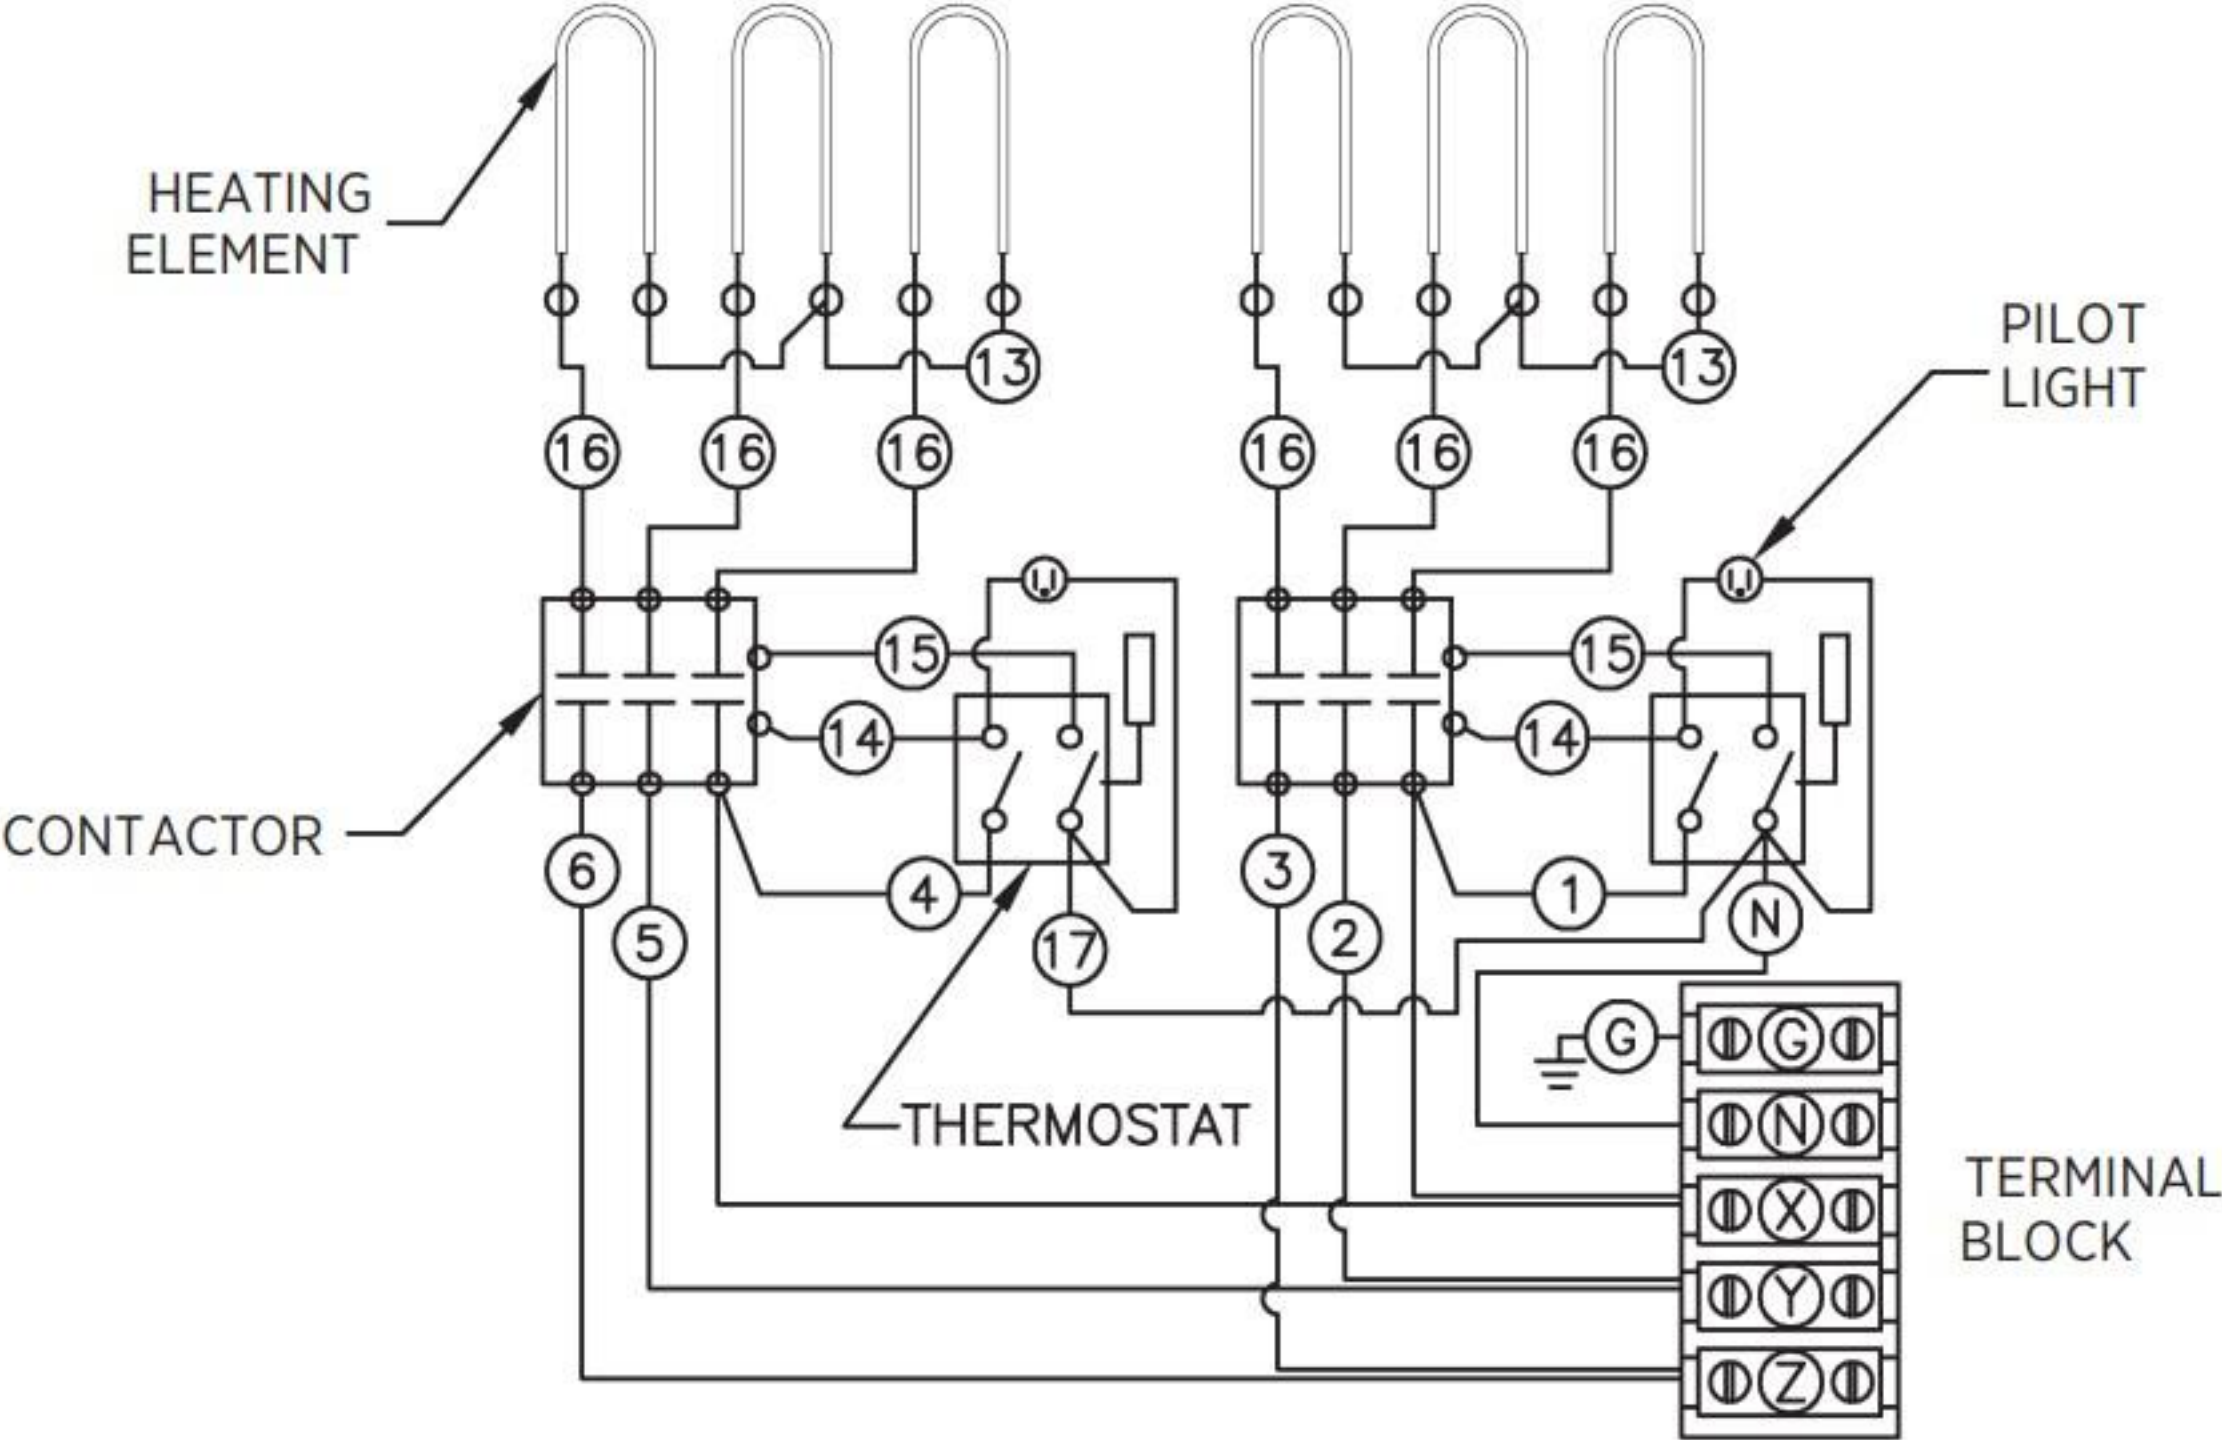



SINGLE PHASE		NOMINAL AMPS PER LINE 3 PH.					
208V	240V	208V-3 PHASE			240V-3 PHASE		
17.4 KW	17.4 KW	17.4 KW			17.4 KW		
X-Y	X-Y	X	Y	Z	X	Y	Z
83.6	72.5	55.3	55.3	36.2	48	48	31.4
AWG #3	AWG #3	AWG #6	AWG #6	AWG #8	AWG #6	AWG #6	AWG #8

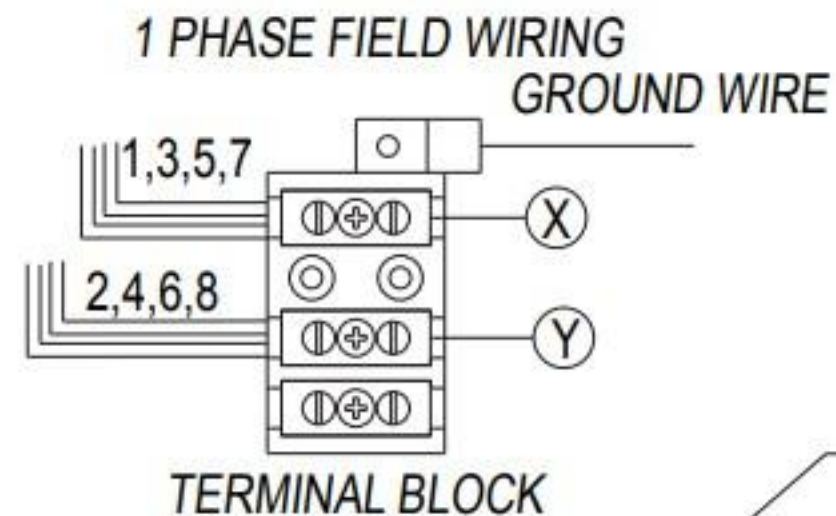

FOR SUPPLY CONNECTION USE
COPPER WIRE ONLY, SUITABLE
FOR AT LEAST 90°C (194°F).
USE GAUGE SHOWN OR LARGER.

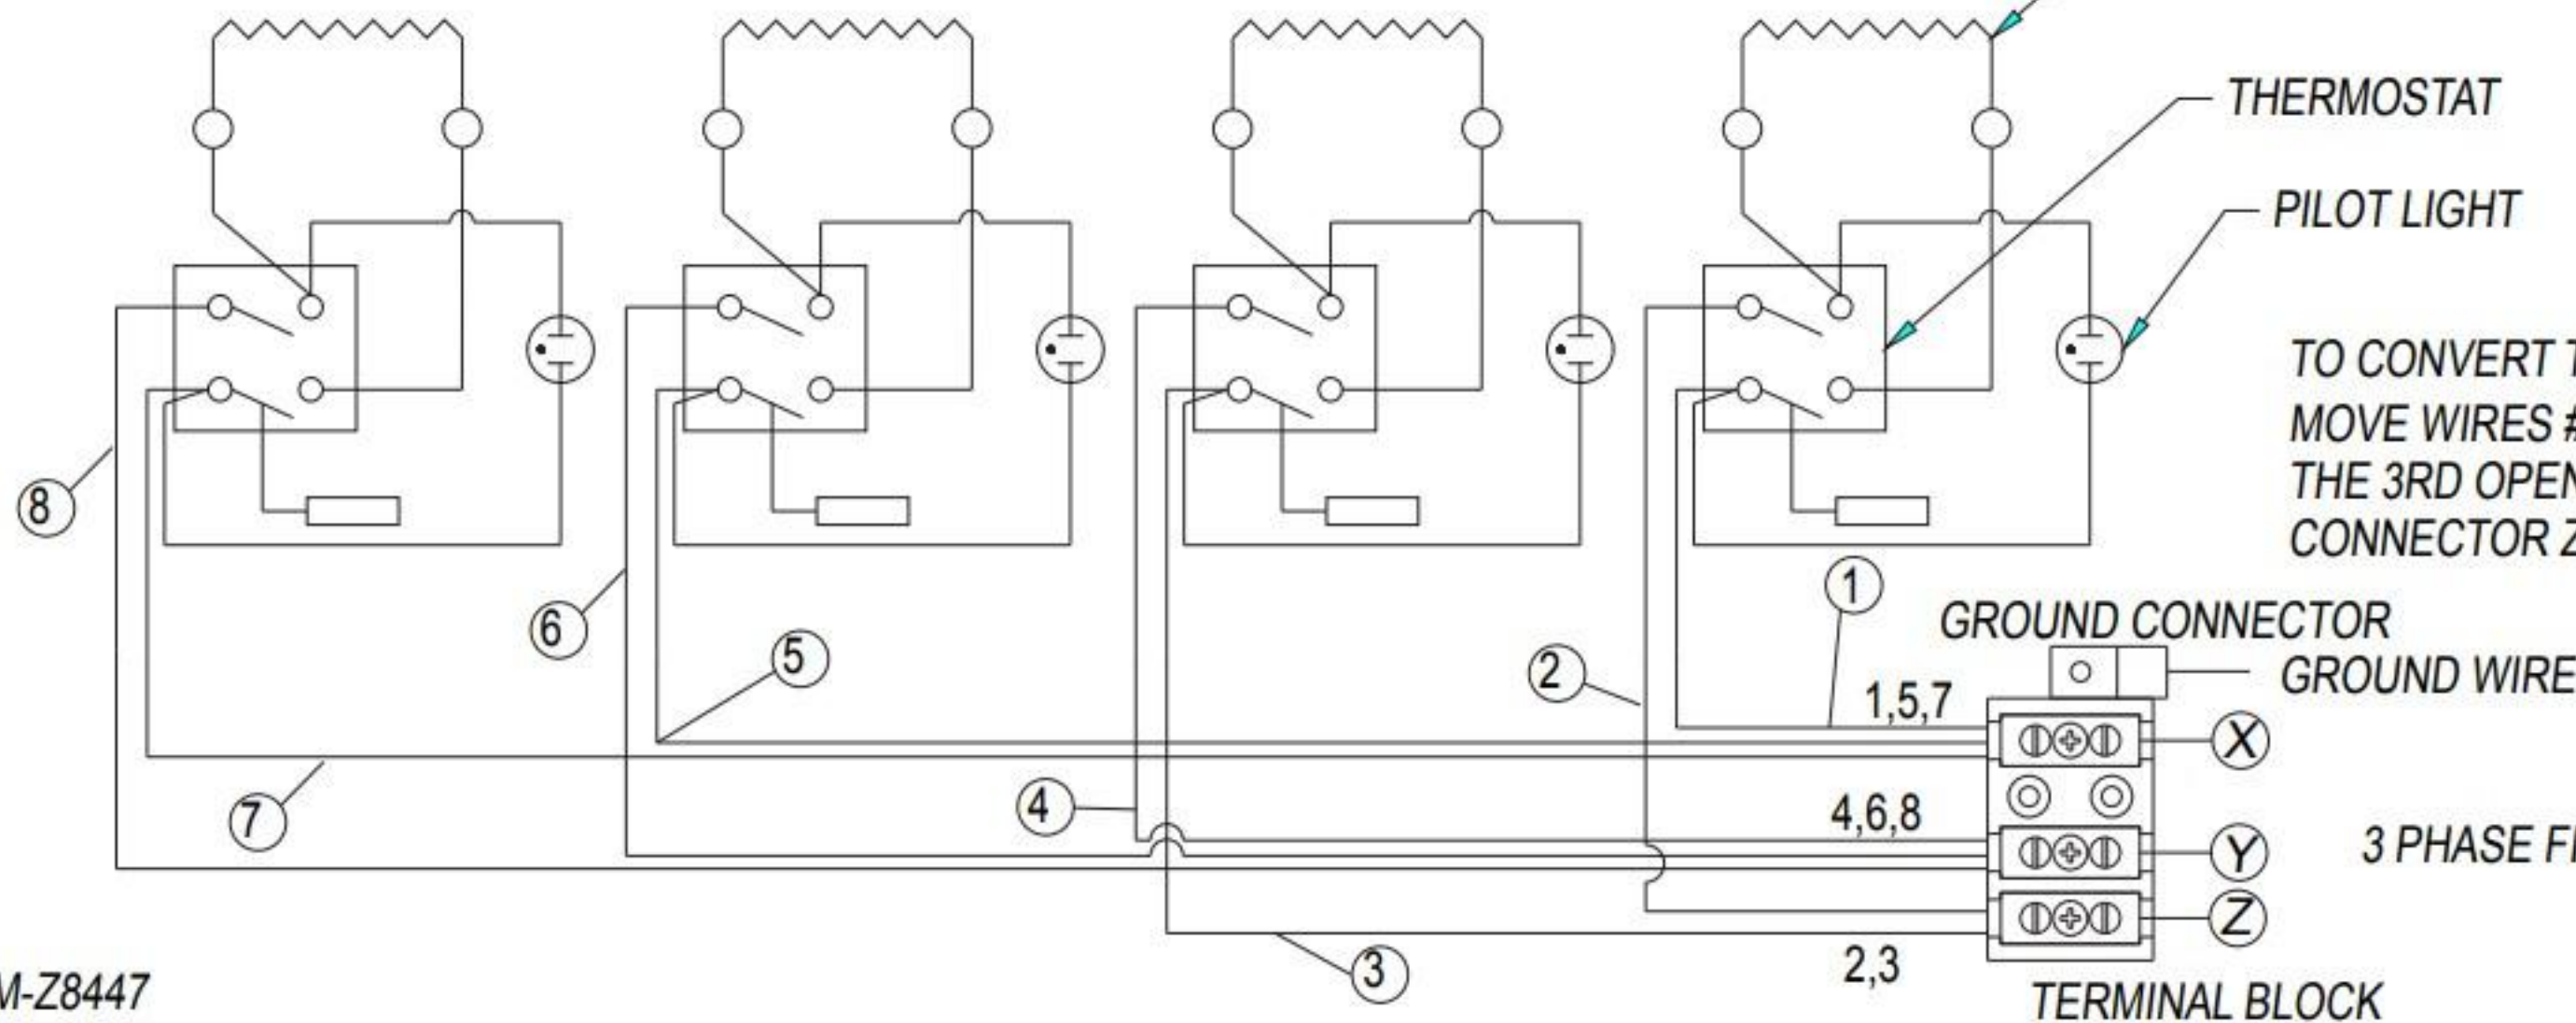

SINGLE PHASE SUPPLY		NOMINAL AMPS PER LINE 3 PH.					
208V	240V	208V-3 PHASE			240V-3PHASE		
13.05 KW	13.05 KW	13.05 KW			13.05 KW		
X-Y	X-Y	X	Y	Z	X	Y	Z
62.7	54.4	36.2	36.2	36.2	31.4	31.4	31.4
AWG #4	AWG #6	AWG #8			AWG #8		

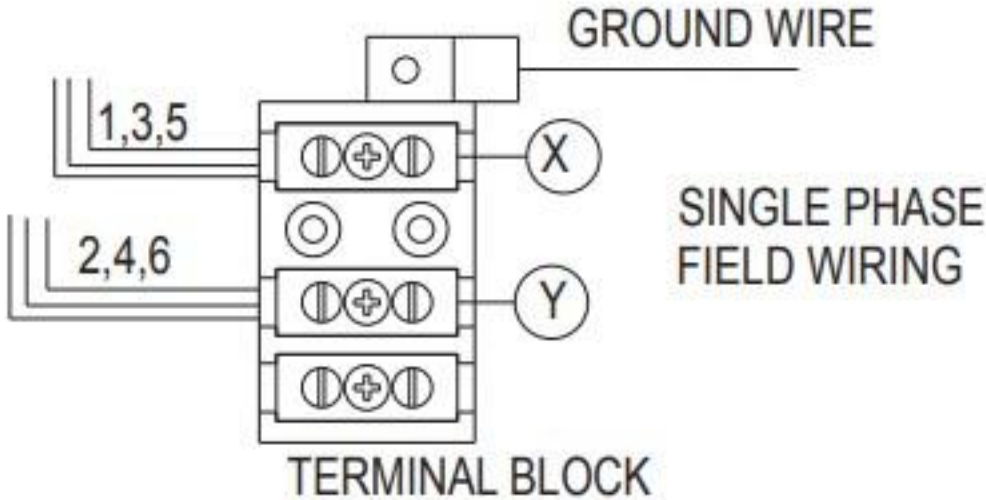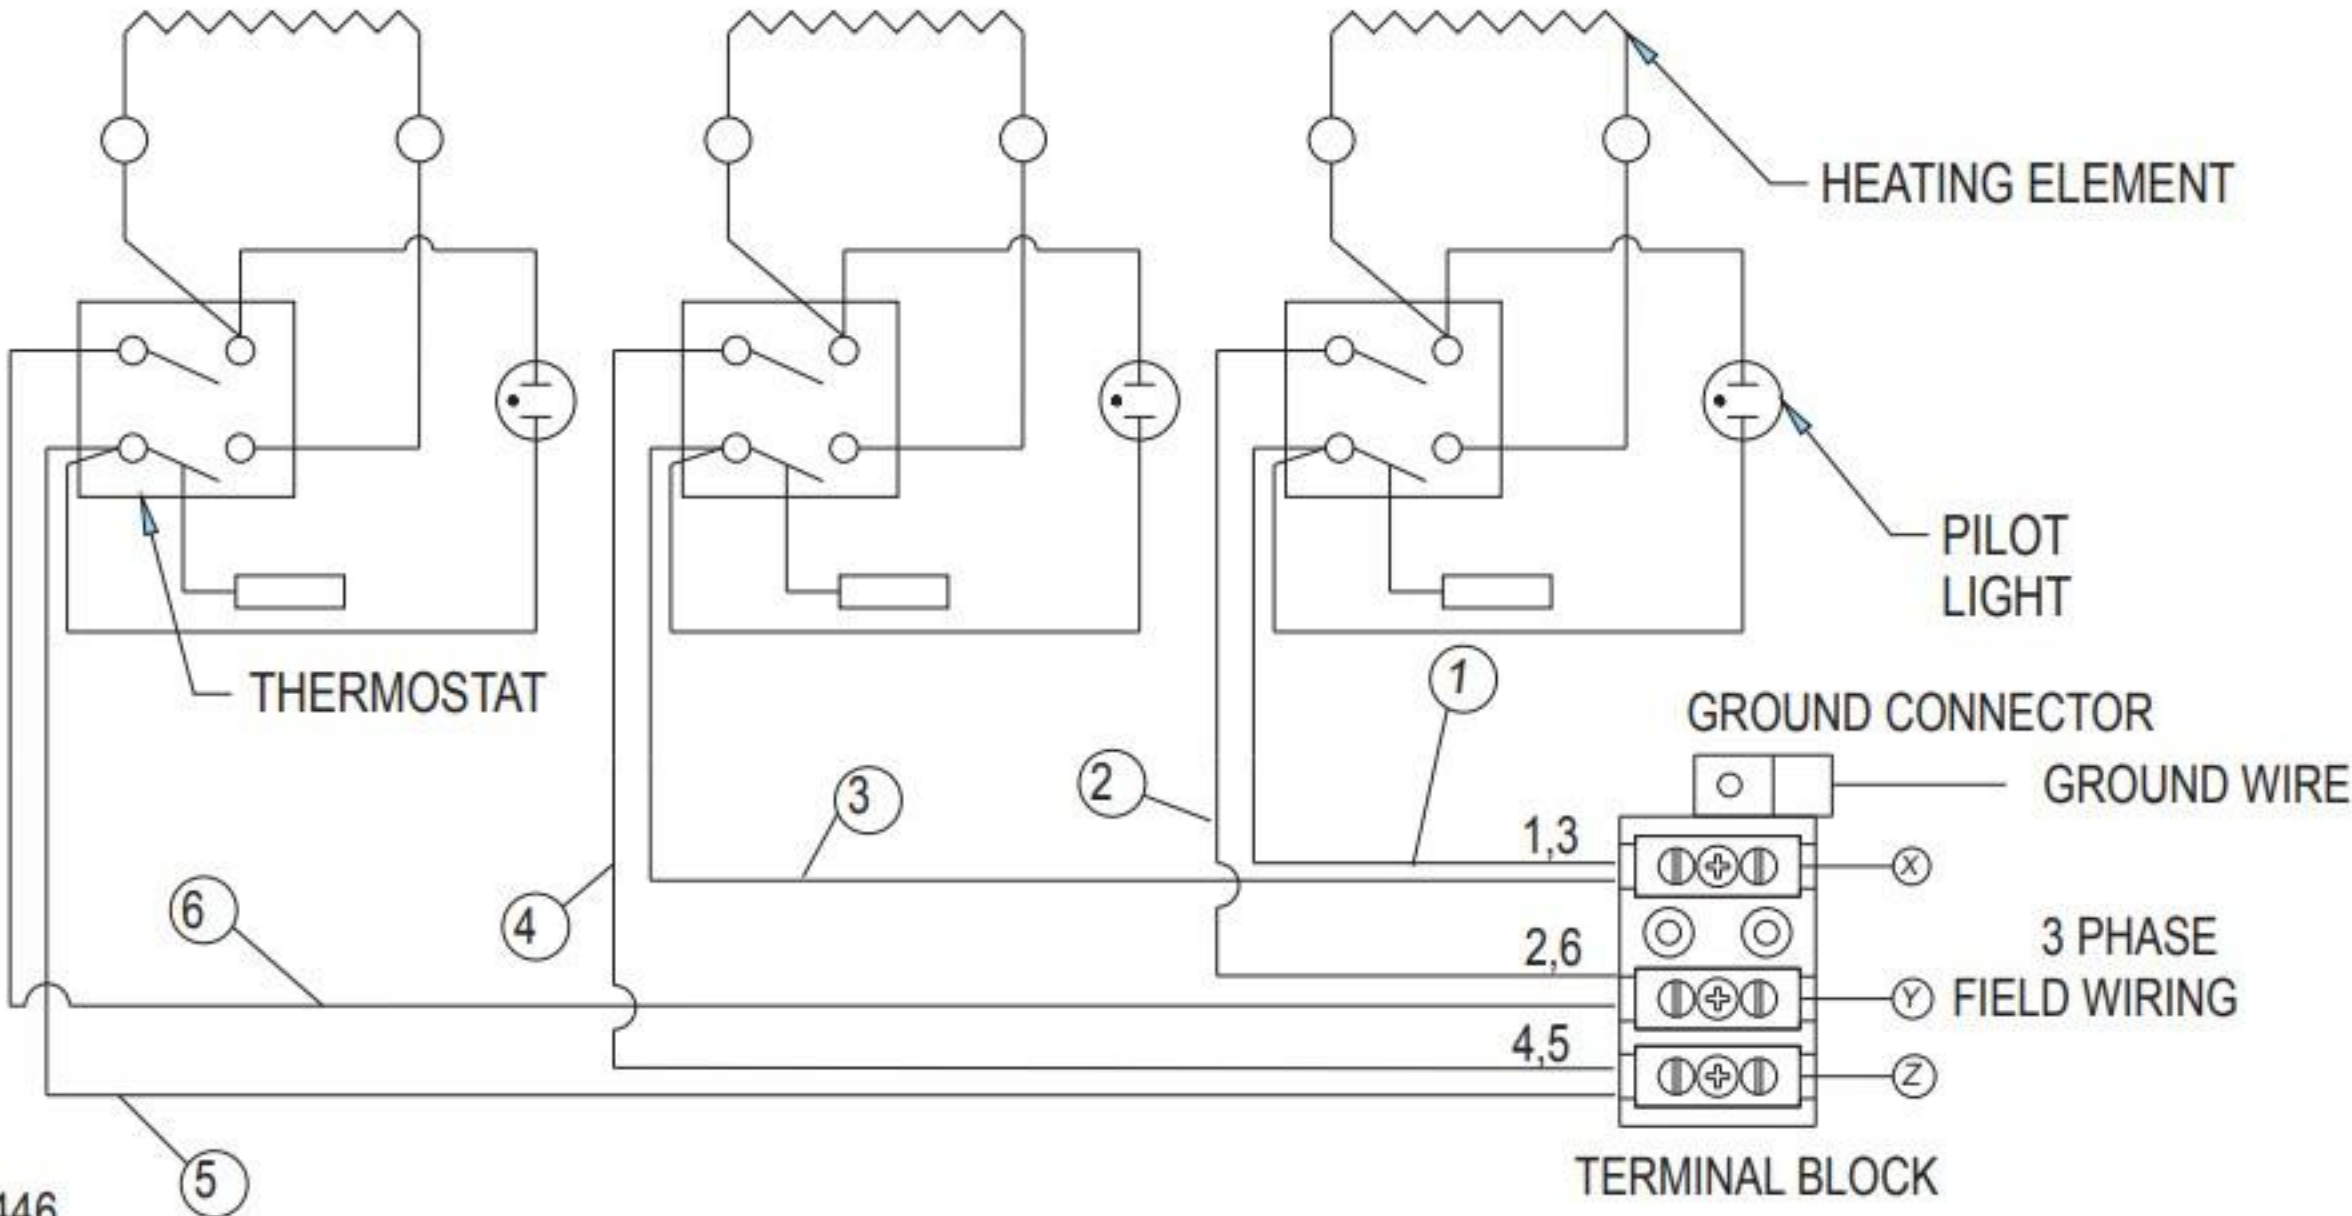


TO CONVERT TO 3 PHASE
MOVE WIRES #4 AND #5 TO
THE 3RD OPEN TERMINAL
CONNECTOR Z SHOWN.

NOTE:
1) FOR SUPPLY
CONNECTIONS USE COPPER
WIRE ONLY, SUITABLE FOR
AT LEAST 90°C (194°F). USE
GAUGE SHOWN OR LARGER.


SINGLE PHASE		NOMINAL AMPS PER LINE 3 PH.					
208V	240V	208V-3 PHASE			240V-3PHASE		
8.7 KW	8.7 KW	8.7 KW			8.7 KW		
X-Y	X-Y	X	Y	Z	X	Y	Z
41.8	36.3	20.9	36.2	20.9	18.1	31.3	18.1
AWG #6	AWG #8	AWG #12	AWG #8	AWG #12	AWG #12	AWG #8	AWG #12

FOR SUPPLY CONNECTIONS USE COPPER WIRE ONLY, SUITABLE FOR AT LEAST 90°C (194°F). USE GAUGE SHOWN OR LARGER.

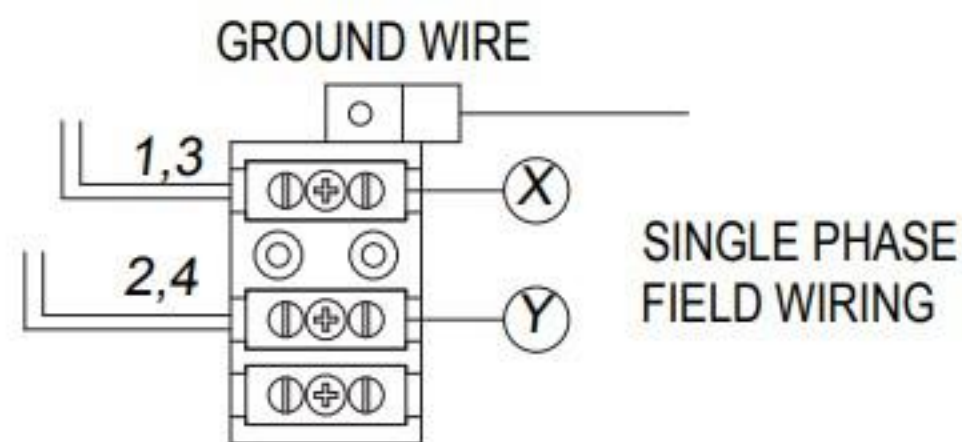

TERMINAL BLOCK

TO CONVERT TO 3 PHASE
MOVE WIRE #3 TO
THE 3RD OPEN TERMINAL
CONNECTOR Z SHOWN.

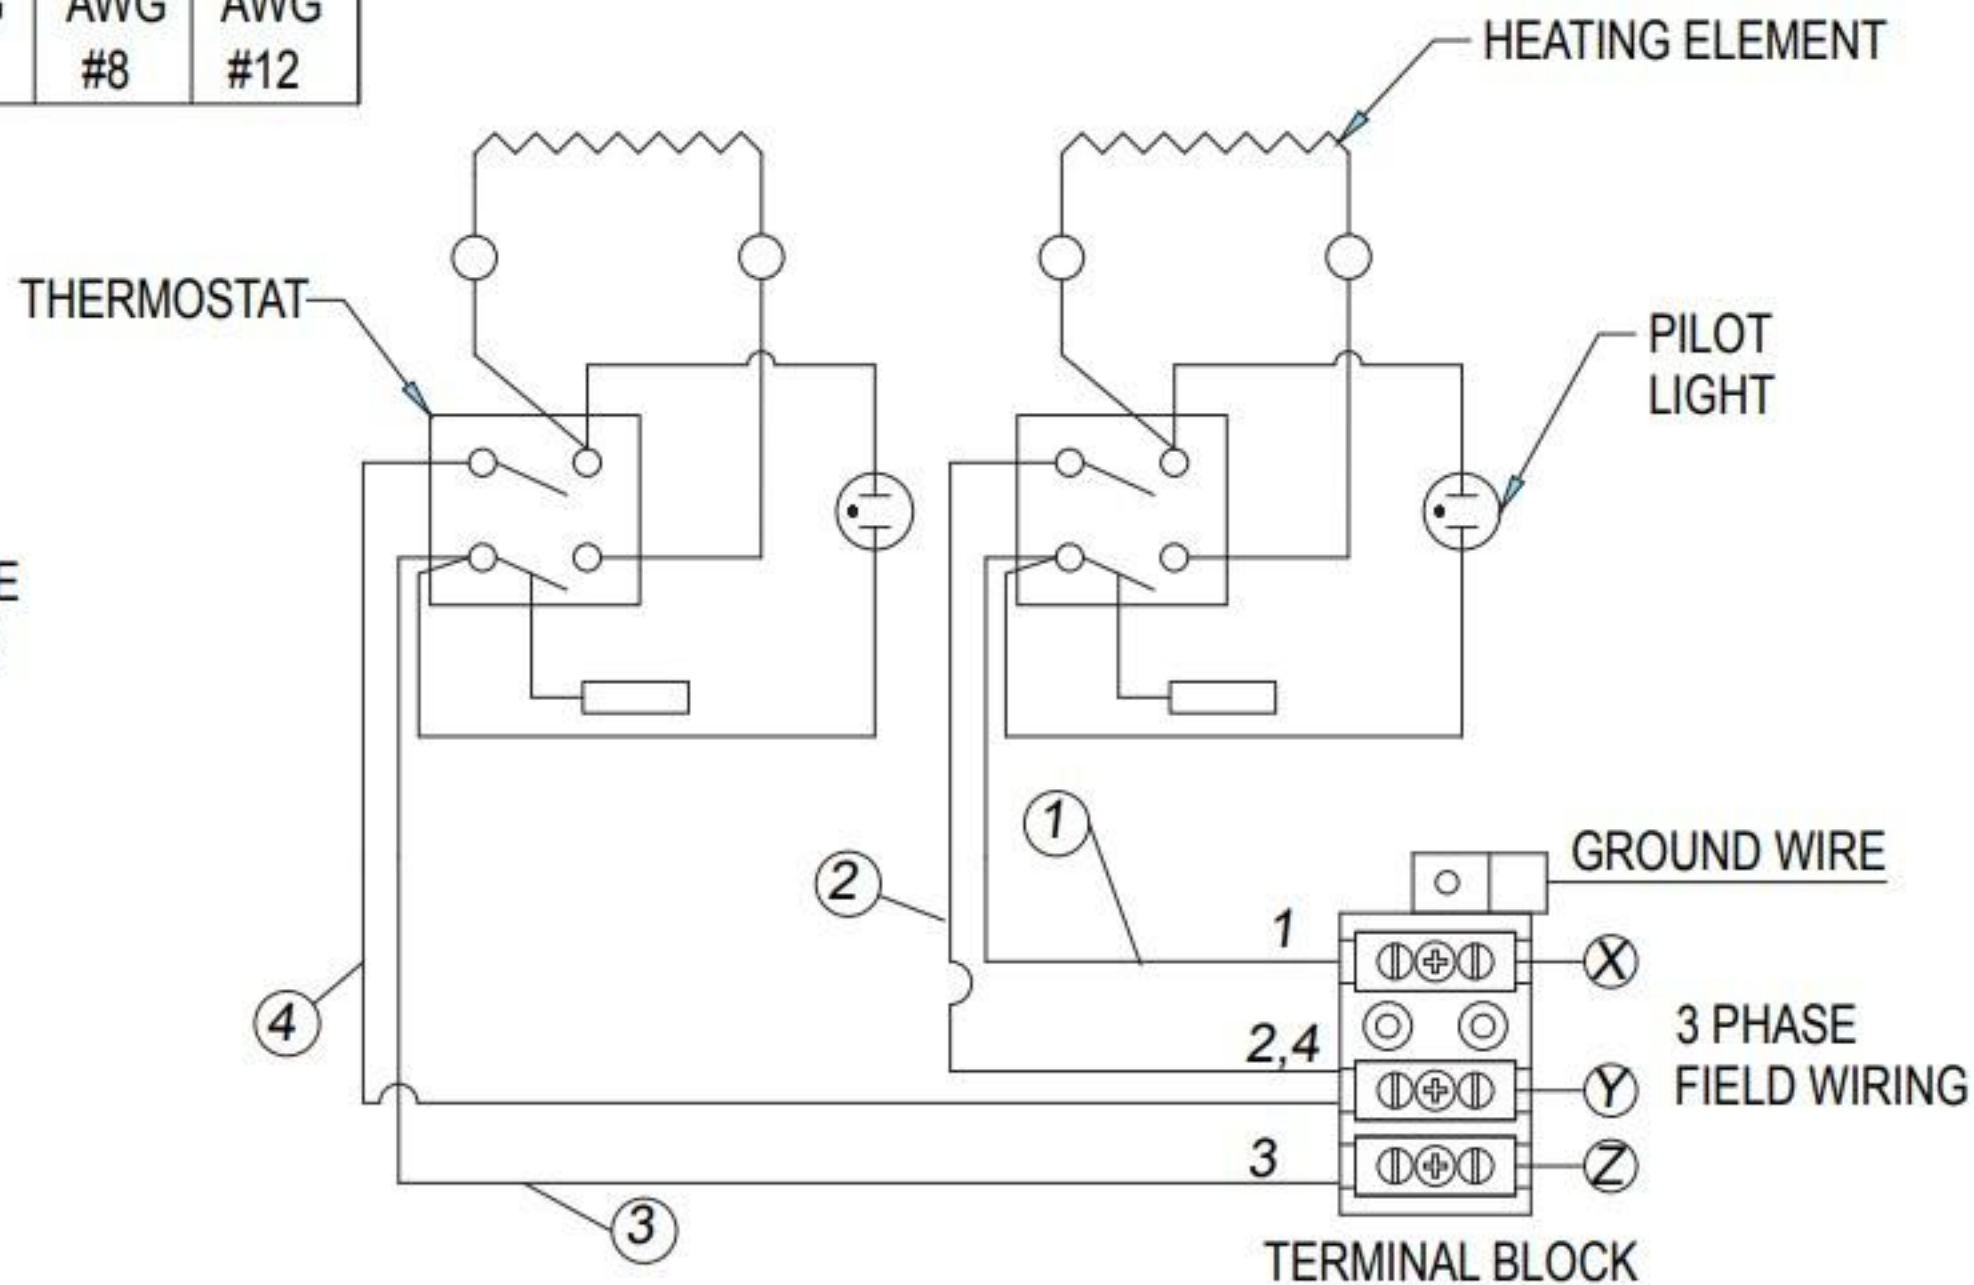

TERMINAL BLOCK